# **Panasonic**

# **INSTRUCTION MANUAL**

# Digital Mark Sensor LX-100 Series

MJE-LX100C No.0021-83V

Thank you very much for purchasing Panasonic products. Please read this Instruction Manual carefully and thoroughly for the correct and optimum use of this product. Kindly keep this manual in a convenient place for quick reference.

# ∕!∖ WARNING


- Never use this product as a sensing device for personnel protection.
- In case of using sensing devices for personnel protection, use products which meet standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.


# 1 SPECIFICATIONS

Туре		Cable type	Connector type			
Model NPN output		LX-101	LX-101-Z			
Item No. PN	IP output	LX-101-P	LX-101-P-Z			
Sensing distance		10 ±	3mm			
Supply voltage		12 to 24V DC±10% Ripple P-P10% or less				
Current consumption		Normal mode: 750mW or less (Current consumption 30mA or less at 24V supply voltage) EOC mode: 600mW or less (Current consumption 25mA or less at 24V supply voltage)				
Teaching input		$ \begin{array}{llllllllllllllllllllllllllllllllllll$				
Output 1 (OUT)		<npn output="" type=""> NPN open-collector transistor <ul> <li>Max. sink current: 50mA (Note 1)</li> <li>Applied voltage: 30V DC or less (between output 1 and 0V)</li> <li>Residual voltage: 1.5V or less [at 50mA (Note 1) sink current]</li> </ul> </npn>	<pnp output="" type=""> PNP open-collector transistor <ul> <li>Max. source current: 50mA (Note 1)</li> <li>Applied voltage: 30V DC or less (between output 1 and +V)</li> <li>Residual voltage: 1.5V or less [at 50mA (Note 1) source current]</li> </ul></pnp>			
Output operation Mark mode: Light-ON / Dark-ON Auto-setting method of Color mode: Coincidence-ON / Non-coincidence-ON						
Short-circuit pro	otection	Incorp	orated			
Output 2 (Inversion output) (OUT)		<ul> <li>NPN output type&gt;</li> <li>NPN open-collector transistor</li> <li>Max. sink current: 50mA</li> <li>Applied voltage: 30V DC or less (between output 2 and 0V)</li> <li>Residual voltage: 1.5V or less (at 50mA sink current)</li> <li>PNP output type&gt;</li> <li>PNP open-collector transistor</li> <li>Max. source current: 50mA</li> <li>Applied voltage: 30V DC or less (between output 2 and +V)</li> <li>Residual voltage: 1.5V or less (at 50mA source current)</li> </ul>				
Output operation		Inverted operation of the output 1	_			
Short-circuit protection		Incorporated	_			
Response time		Mark mode: $45 \mu$ s or less, Color mode: $150 \mu$ s or less				
Operation indicator		Orange LED (lights up when output 1 is ON)				
MODE indicator		'RUN': Green LED, 'TEACH', 'ADJ', 'COLOR', 'TIMER', 'PRO': Yellow LED				
Digital display		4 digits red LED display				
Sensitivity setting		Mark mode: 2-level teaching / Full-auto teaching, Color mode: 1-level teaching				
Fine sensitivity adjustment function		Incorporated				
Timer function		Incorporated OFF-delay timer / ON-delay timer, switchable either effective or ineffective				
Protection		IP67 (IEC)				
Ambient temper	ature	-10 to +55°C (No dew condensation or icing allowed), Storage: -20 to +70°C				
Ambient humidi	ty	35 to 85% RH, Storage: 35 to 85% RH				
Emitting elemen	nt	Red / green / blue LED				
Material		Enclosure: PBT, Display: Polycarbonate, Operation buttons: Silicone rubber, Lens: Gla				
Cable		0.2mm <sup>2</sup> 5-core cabtyre cable, 2m long	<del></del> -			

Notes: 1) The connector type **LX-101** □-**Z** is 100mA.

2) The connecting cable is not supplied as an accessory for the connector type LX-101 □-Z. Make sure to use the optional cables with connector below: CN-24B-C2 (Straight type, 4-core, Cable length: 2m) CN-24BL-C2 (Elbow type, 4-core, Cable length: 2m) CN-24B-C5 (Straight type, 4-core, Cable length: 5m) CN-24BL-C5 (Elbow type, 4-core, Cable length: 5m)





# **2** CAUTIONS

- This product has been developed / produced for industrial use only.
- Make sure to carry out wiring in the power supply off condition.
- Take care that wrong wiring will damage the sensor.
- Verify that the supply voltage variation is within the rating.
- Take care that if a voltage exceeding the rated range is applied, or if an AC power supply is directly connected, the sensor may get burnt or damaged.
- In case noise generating equipment (switching regulator, inverter motor, etc.) is used in the vicinity of this product, connect the frame ground (F.G.) terminal of the equipment to an actual ground.
- If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- Take care that short-circuit of the load or wrong wiring may burn or damage the sensor.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.
- Take care that the sensor is not directly exposed to fluorescent light from a rapid-starter lamp or a high frequency light device or sunlight etc., as it may affect the sensing performance.
- If the surface of the sensing object has a shine, mount the sensor inclining approx. 10 to 15 degrees against the sensing object.
- Do not touch the lens of the sensor by hand directly. If the lens becomes dirty, wipe it off with a soft cloth gently.
- When the inside lens is steamed up, unscrew the lens to get rid of the condensation.
- For **LX-101-**□**-Z**, be sure to use the optional cable with connector.
- Extension up to total 100m is possible with 0.3mm<sup>2</sup>, or more, cable. However, in order to reduce noise, make the wiring as short as possible.
- This sensor is suitable for indoor use only.
- Do not use this sensor in places having excessive vapor, dust, etc., or where it may come in direct contact with water, or corrosive gas.
- Take care that the product does not come in contact with water, oil, grease, or organic solvents, such as, thinner, etc.
- Make sure that stress by forcible bend or pulling with 76N, or more, force is not applied to the sensor cable joint.
- This sensor cannot be used in an environment containing inflammable or explosive gases.
- Never disassemble or modify the sensor.

# 3 MOUNTING

0.8N m or less.

 Care must be taken regarding the sensor mounting directrion with respect to the object's direction of movement.

The tightening torque should be


Not good Do not make the sensor detect an object in this direction because it may cause unstable operation.

M4 screw with washers

Good


Sensor mounting MS-LX-1 (Optional)

## **4 PART DESCRIPTION**

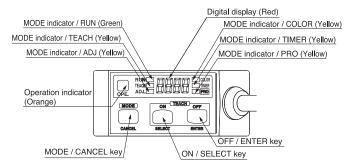

# 5 I/O CIRCUIT DIAGRAMS

## NPN output type

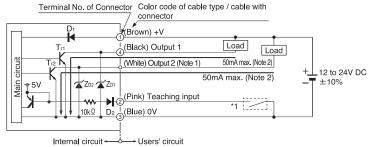


Notes: 1) The output 2 is not incorporated to connector type LX-101 □-Z.


2) The current of the connector type LX-101 □-Z is 100mA.




Rugghölzli 2 CH - 5453 Busslingen Tel. +41 (0)56 222 38 18 Fax +41 (0)56 222 10 12 mailbox@sentronic.com www.sentronic.com



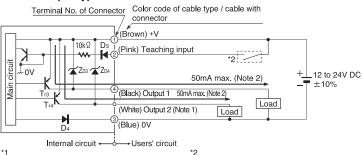






Notes: 1)The inverting output is not incorporated to connector type **LX-101**□**-Z**. 2)The current of the connector type **LX-101**□**-Z** is 100mA.

Symbols... D1, D2, D3, D4: Reverse supply polarity protection diode Z01, Z02, Z03, Z04: Surge absorption zener diode Tr1, Tr2: NPN output transistor Tr3, Tr4: PNP output transistor

■ Layout of connector pin of connector type LX-101 □-Z



## **6** OPERATION PROCEDURE

Before performing teaching or each detail setting, perform the setting of either mark mode or color mode with mark / color mode setting of NAVI mode.

#### NAVI mode

RUN	Run			
Indicates relative v At color	mode setting: the absolute value of eralue (percent value) againmode setting: color matching degree w			
		Press		
TEACH	Teaching	Refer to '10 TEACHING MODE'.		
At mark mode setting: Sets the threshold value by '2-level teaching' or 'full-auto teaching'. At color mode setting: Sets the threshold value by '1-level teaching'.				
		Press		
ADJ	Adjust	- 4 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1		
700	Aujust	Refer to ' III ADJUST MODE'.		
At mark	mode setting: Allows fin	Refer to '[1] ADJUST MODE'.  e adjustment of the threshold value.  djustment of sensing tolerance value.		
At mark	mode setting: Allows fin	e adjustment of the threshold value.		
At mark	mode setting: Allows fin	dijustment of the threshold value.		
At mark At color	mode setting: Allows fin mode setting: Allows ac	disconnections of the threshold value.		
At mark At color	mode setting: Allows fin mode setting: Allows ac Mark / Color mode setting	disconnections of the threshold value.		
At mark At color	mode setting: Allows fin mode setting: Allows ac Mark / Color mode setting	e adjustment of the threshold value.  djustment of sensing tolerance value.  Press  Refer to ' 7 MARK/COLOR MODE SETTING  Press  MARK/COLOR MODE SETTING		
At mark At color  COLOR Sets mark	mode setting: Allows fin mode setting: Allows ac Mark / Color mode setting k mode or color mode.	e adjustment of the threshold value.  lijustment of sensing tolerance value.  Press  Refer to ' 7 MARK / COLOR MODE SETTING'  Press  CHOOSE  Press		
At mark At color  COLOR Sets mark	mode setting: Allows fin mode setting: Allows ac Mark / Color mode setting k mode or color mode.  Timer operation setting	e adjustment of the threshold value.  lijustment of sensing tolerance value.  Press  Refer to ' MARK/COLOR MODE SETTING'  Press		
At mark At color  COLOR Sets mark	mode setting: Allows fin mode setting: Allows ac Mark / Color mode setting k mode or color mode.  Timer operation setting	Refer to 12 TIMER OPERATON SETTING MODE  (M8880)  Press  Refer to 12 TIMER OPERATON SETTING MODE		


# MARK / COLOR MODE SETTING

This product enables to select the applicable mark / color mode depending on the using purpose. Before carrying out teaching or each setting, set the mark / color mode in COLOR of NAVI mode.



Since the available functions differ depending on the selected mode, take care when setting mode. (The factory setting of this product is mark mode.)

- · Mark mode: Detects incident light intensity at receiving part.
- Color mode: Detects color ratio of the sensing object. This mode can be used when desired to detect a specific color only.
- The mode is selected using either 'ON / SELECT key' or 'OFF / ENTER key'.



Note: Press 'MODE / CANCEL key' to confirm.

# 8 DIRECT CODE DISPLAY

- When MODE indicator / RUN (green) lights up, the direct code is displayed on the digital display by pressing 'MODE / CANCEL key' for more than
- RUN COLOR TEACH TIMER ADJ

2 seconds. (The direct code is turned off when stop pressing the 'MODE / CANCEL key', ) The current setting status can be confirmed at a glance with the direct code.

#### Direct code

	1st figure		2nd figure		3rd figure		4th figure		
Direct code	Mark / color mode	Operation mode	Sensing mode	Disp <b>l</b> ay mode	Eco mode	Display invert- ing mode	Key lock mode	Timer mode	Timer period
	Mark mode (GREEN)	Light-ON	FINE	STANDARD	OFF	OFF	FULL lock	Without timer	1ms
1			COARSE			ON		OFF-Delay	2ms
2		Dark-ON	FINE		ON	OFF		ON-Delay	5ms
3			COARSE			ON		Without timer	10ms
4	Mark mode (BLUE)	Light-ON	FINE	P (Displayed	OFF	OFF	RUN TEACH <b>I</b> NG	OFF-Delay	20ms
5			COARSE		OFF	ON		ON-Delay	50ms
5		Dark-ON	FINE	in percent- age)	ON	OFF	RUN ADJUST	Without timer	100ms
7			COARSE		ON	ON		OFF-Delay	200ms
8		Limbs ON	FINE	_	_	_		ON-Delay	500ms
9	Mark mode	Light-ON	COARSE	_	_	_		_	
A	(RED)	ED) Dark-ON	FINE	_	_	_	_		_
Ь			COARSE	—	_	_		_	
٥		C o i n c i- dence ON	FINE	_	_	_	_	_	_
d			COARSE						
E	Color mode	Incoinci-	FINE	_				_	_
F	dence		COARSE	_	_	_	_	_	

Note: For details, refer to ' 13 PRO MODE '.

# **9** KEY LOCK FUNCTION

- The key operation is locked by pressing both 'MODE / CANCEL key' and 'OFF / ENTER key' for more than 2 seconds simultaneously when MODE indicator / RUN (green) lights up.
- RUN COLOR TEACH TIMER ADJ PRO
- In order to release the key lock, press both 'MODE / CANCEL key' and 'OFF / ENTER key' for more than 2 seconds again.

# 10 TEACHING MODE

 The teaching setting can be done when MODE indicator / TEACH (yellow) lights up.




- The applicable teaching for mark mode and color mode is differed in the teaching mode as shown below:
  - Mark mode: Sets either 2-level teaching or full-auto teaching.
  - Color mode: Sets 1-level teaching

Note: If stable sensing becomes impossible by environmental effect etc., carry out the teaching again.

In case of mark mode

## <In case of 2-level teaching>




- 1. Press 'MODE / CANCEL key' to light up 'MODE indicator / TEACH (yellow)'.
  - When setting the output to ON with mark, press 'ON / SELECT key' while aligning the beam spot, and when setting the output to OFF, press 'OFF / ENTER key. ' { 5 the blinks.
- Align the beam spot to the base (non-mark area) of the mark to be detected. When 'ON / SELECT key' is pressed at the step 1, press 'OFF / ENTER key, and when 'OFF / ENTER key' is pressed at the step 1, press 'ON / SELECT key'.
   12. nd ' blinks.
- 3. The threshold value is set at the mid-value between the step 1 and 2.
  - In case stable sensing is possible : ' **good** ' is displayed on the digital display.
  - In case stable sensing is impossible: ' ĂĀrd ' is displayed on the digital display.



Rugghölzli 2 CH - 5453 Busslingen Tel. +41 (0)56 222 38 18 Fax +41 (0)56 222 10 12 mailbox@sentronic.com www.sentronic.com



#### <In case of full-auto teaching>



- Press 'MODE / CANCEL key' to light up MODE indicator / TEACH (yellow). In the state where the sensing objects are moving on the assembly line, align the beam spot to the position where the mark on the object passes through.
- 2. When setting the output to on for the side with less incident light intensity, press 'ON / SELECT key', and when setting the output to on for the side with more incident light intensity, press 'OFF / ENTER key' for more than 2 seconds. ' Rute ' is displayed, and sampling begins.
- 3. In case stable sensing is possible : ' and ' is displayed on the


In case stable sensing is impossible:

digital display.

'HRrd' is displayed on the digital display. Slow down the speed of the assembly line, and carry out the teaching again.

## In case of color mode

#### <In case of 1-level teaching>



- Press 'MODE / CANCEL key' to light up MODE indicator / TEACH (yellow).
  - Align the beam spot to the mark to be detected.
  - 2. When setting the output to ON with mark, press 'ON / SELECT key', and when setting the output to OFF, press 'OFF / ENTER key'. ' 1.51' blinks.
- 3. In case stable sensing is possible : '**!aad** ' is displayed on the digital display.
  - In case stable sensing is impossible: ' Fri

' **Frr** ' is displayed on the digital display, and the setting value is reset to the pre-teaching value.

## **11** ADJUST MODE

 The following settings can be done when MODE indicator / ADJ (yellow) lights up.



#### In case of mark mode: Fine adjustment of threshold value

 The threshold value is fine adjustable using 'ON / SELECT key' or 'OFF / ENTER key'.

#### In case of color mode: Set judging tolerance

- The judging tolerance setting is the function that can change the judging tolerance with respect to the taught reference color.
- Even if the tolerance is changed, the information of the reference color taught earlier does not change.
- The judging tolerance value increases with 'ON / SELECT key', and decreases with 'OFF / ENTER key'.


Notes: 1) Press 'MODE / CANCEL key' to confirm.

2) The numerical value indicated in the digital display should be used as a reference.

# **I!** TIMER OPERATION SETTING MODE

- The setting for whether the timer is used or not can be done when MODE indicator / TIMER (yellow) lights up.
- The initial value of each timer function is 20ms.
- Refer to ' PRO MODE' for the setting delay timer, OFF-delay timer and ONdelay timer

Note: Press 'MODE / CANCEL key' to confirm.

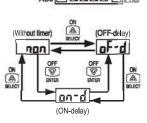

## <Time chart>

Timer operation	Sensing condition Operation	Beam- interrupted
Without timer	Light-ON / coincident ON	ONOFF
without timer	Dark-ON / incoincident ON	ON OFF
OFF-delay timer	Light-ON / coincident ON	ON
OFF-delay time	Dark-ON / incoincident ON	TON
ON-delay timer	Light-ON / coincident ON	→ T ON OFF
ON-delay timer	Dark-ON / incoincident ON	


Timer period: T-1 to 500ms 9-step variable

# 13 PRO MODE

• The setting for whether PRO is used or not can be done when MODE indicator / PRO (yellow) lights up. For confirming each selected setting item, press 'OFF / ENTER key'. After confirming setting, the digital display flashes.



For canceling setting, press 'MODE / CANCEL key'.

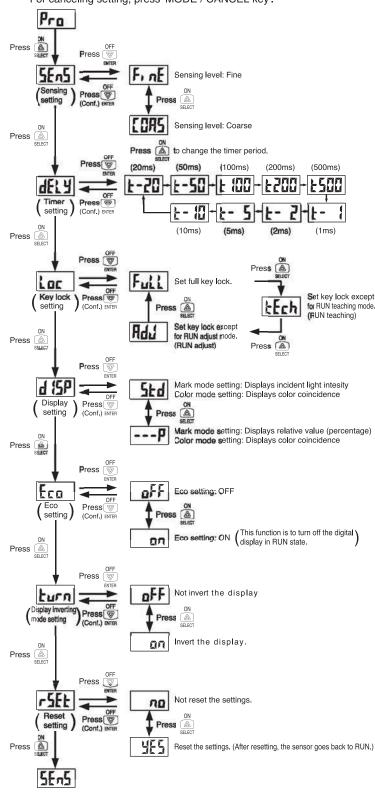

Function	Factory setting	Description
Sensing setting	FINE	Sets the sensing level (hysteresis.)
Timer setting	F-50	Sets timer setting period by 9-steps.
Key lock setting	Full	Selects key lock function.
Display setting	Std	Selects display method of digital desplay.
Eco setting	oFF	Sets ON / OFF of eco mode.
Display inverting mode setting	oFF	Changes display direction of digital display.
Reset setting	חם	Resets to factory setting.



# **EXTERNAL TEACHING FUNCTION**

 This product incorporates the external teaching function. Take care that the teaching methods for mark mode and color mode differ in the external teaching function.

#### In case of mark mode

#### <2-level teaching>



TEACH TEACH

- Align the beam spot to the mark to be detected in 'RUN mode'
- Input the external signal for 20ms or more in step 1 state. (Do not input the external signal more than 2 sec. continuously.)
  - 3. Align the beam spot to the base (non-mark area), and input the external signal for 20ms or more.

(Timing chart)



#### <Full-auto teaching>



1. Put the object on the assembly line at 'RUN mode' state.



 When the external signal is input for 2 sec. or more, sampling begins. When sampling finishes, the digital display flashes. If ' \( \mathbb{H}\mathbb{H}\mathbb{H}\mathbb{d}'\) is displayed, slow down the line speed, and carry out the teaching again.



Note: When the full-auto teaching is used, the output operation is set to 'DARK-ON'.

#### In case of color mode

## <1-level teaching>



 Align the beam spot to the mark to be detected in 'RUN mode'.



2. Input the external signal for 20ms or more in step 1 state.

(Timing chart)



# 15 OUTPUT 2 (INVERSION OUTPUT) (OUT) (For LX-101 ☐ type only)

The LX-101□ cable type incorporates the output 2 (inversion output) (OUT). For teaching, this function is convenient for inverting logic of LIGHT-ON / DARK-ON (mark-mode), and coincidence-ON / incoincidence-ON (color mode). When the output 2 is used, connect the output wire (output 2) to +V side (oV side for PNP output type). When the output 2 is not used, be sure to insulate it.


# **16 ERROR DISPLAY**

■ Take measurment for the error as shown below:


Display	Error content	Remedy
Er-1	Shorten the load and flows overcurrent.	Turn off the power supply and check the load.

# **17** DIMENSIONS (Unit: mm)


● Cable type / LX-101 □

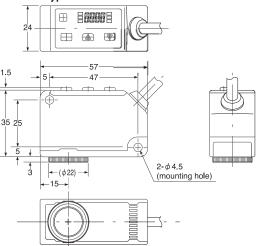


#### ■ Connector type / LX-101 □ -Z

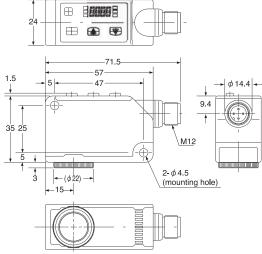

## Sensor mounting bracket / MS-LX-1 (Optional)

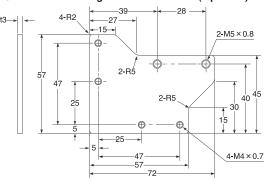

#### Sensor mounting bracket / MS-LX-2 (Optional)

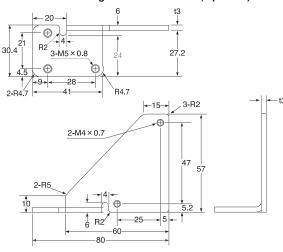

# **18** INTENDED PRODUCTS FOR CE MARKING

 The models listed under ' SPECIFICATIONS' come with CE Marking.

As for all other models, please contact our office.

