Digital Mark Sensor Amplifier Built-in
LX-100 SERIES

Related Information

CE Conforming to EMC Directive

UL Recognition

PNP — PNP output type available

TIMER — Timer

Automatic sensitivity setting

Introduction of the 3 LED mark sensor

Can detect any mark!

Coaxial reflective optics and a sharp 1 × 5 mm 0.039 × 0.197 in spot enable high precision sensing. Stable detection of marks is possible.

3 LED Newly developed

R•G•B light emitting elements all in one
To detect any marking, this unit is equipped with red, green and blue LED light emitting elements all in one.

High precision coaxial reflective optical system
Panasonic Electric Works SUNX's unique coaxial reflective optics technology ensures very accurate sensing. The unit is made with a scratchproof glass lens.

Total reflection mirror

Half mirror

Glass lens

▲ Image schematic

4-digit digital display
The 4-digit digital display enables numerical sensing control and minute settings.

Operation panel
3 large buttons that click into position making operation easy.

Highest in the industry

12-bit A/D converter
A resolution of 1/4,000 is realized to enable high precision mark sensing.

Receiving element

Protection IP67
Washing the machines and production line with water will not affect the sensor thanks to its waterproof construction.
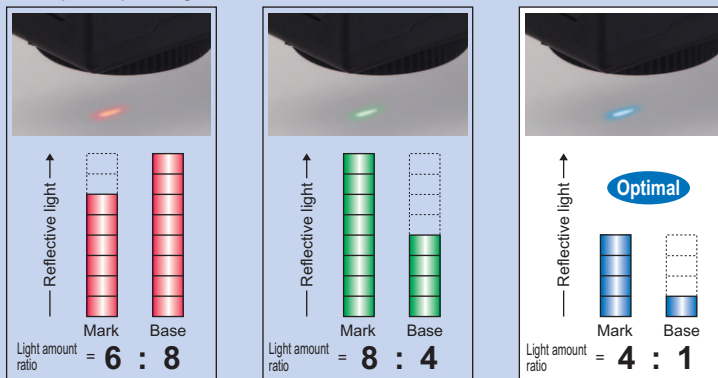
Spot size 1 × 5 mm 0.039 × 0.197 in approx.

Automatic optimal LED selection function

The 3 colors of the R•G•B LEDs are optimally selected according to the color combination. With the **LX-100**'s Mark mode, the built-in "Automatic optimal LED selection function" automatically selects the LED for the largest contrast (S / N ratio) between the mark and base (non-mark area) to ensure optimal sensing. For more stable detection, the sensor makes selection according to the contrast and not according to the reflected light variation between the mark and base (non-mark area).

The example on the right deals with reflected light on packing film.
Great figures are indicated for the blue LED's light amount ratio and, for even more stable sensing, the blue LED effectuates this mark sensing.

Example: A packing film

Reflective light →
Light amount ratio = **6 : 8**
Mark   Base

Reflective light →
Light amount ratio = **8 : 4**
Mark   Base

Optimal
Reflective light →
Light amount ratio = **4 : 1**
Mark   Base

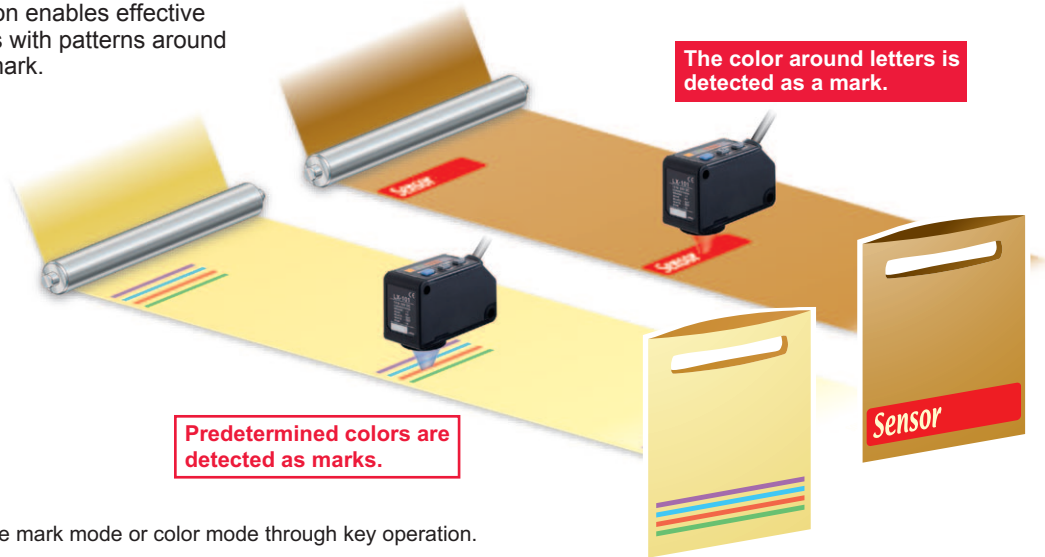## Two detection modes can be selected from to suit the application

Mark mode `Ultra high-speed response`

This sensing mode automatically selects a single color from the 3 R•G•B LEDs to achieve an ultra quick 45 µs response time. The automatic optimal LED selection function automatically selects the LED that is most suitable for the sensing. This function is perfect for ultra quick sensing.

Automatic selection of the optimal LED

RED

GREEN

BLUE
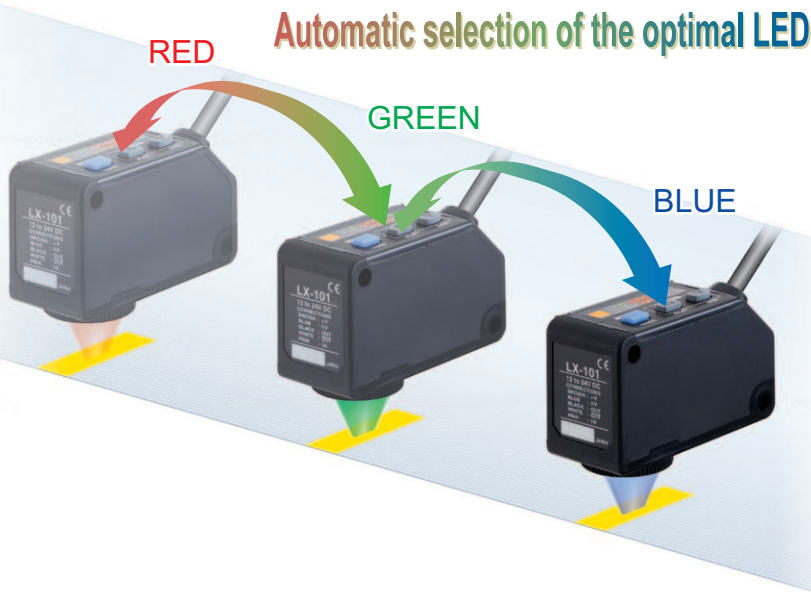
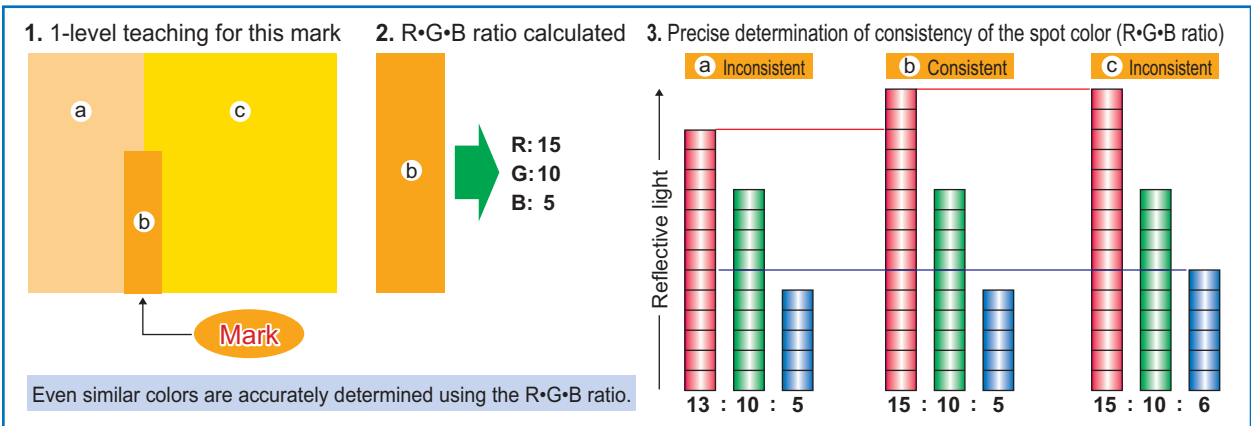### Color mode `High precision discrimination`

All 3 R•G•B LEDs light up and high precision mark color discrimination occurs using the R•G•B reflective light ratio. This function enables effective detection of films with patterns around the area of the mark.

The color around letters is detected as a mark.

Predetermined colors are detected as marks.

Sensor

* You can select the mark mode or color mode through key operation.

High precision mark color discrimination

The color mode on the **LX-100** series utilizes all 3 R•G•B LEDs to determine the R•G•B ratio of the mark color. The built-in 12-bit A/D converter enables high precision 1/4,000-resolution judgments. The figure below is a graphic description of this process.

1. 1-level teaching for this mark

a

c

b

Mark

Even similar colors are accurately determined using the R•G•B ratio.

2. R•G•B ratio calculated

b

R: 15
G: 10
B: 5

3. Precise determination of consistency of the spot color (R•G•B ratio)

a Inconsistent   b Consistent   c Inconsistent

Reflective light

13 : 10 : 5   15 : 10 : 5   15 : 10 : 6

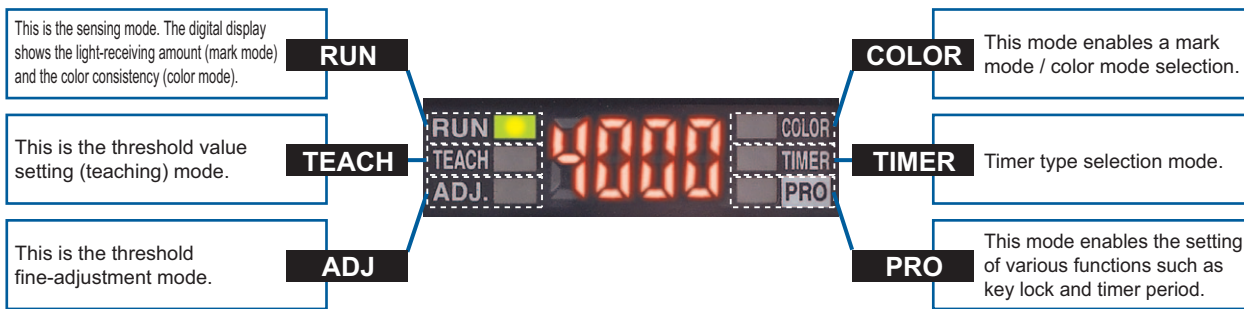Produkte, Support und Service

SENTRONIC AG

Its digital display makes settings easy! Numerical control of the settings is possible

The 4-digit digital display enables easy verification of received light from marks and base (non-mark area). Also, the threshold value can be controlled numerically enabling setting indication easily. Displaying the direct code enables settings verification. This function is handy for remote maintenance.

MODE indicator

Operation indicator

4-digit digital display
(Light-receiving amount and setting values are displayed.)

MODE indicator

MODE key
(PRO mode: CANCEL key)

OFF key
(PRO mode: ENTER key)

ON key
(PRO mode: SELECT key)

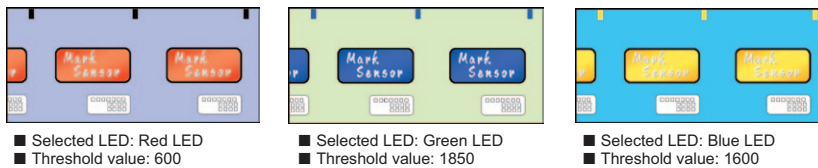## Even beginners can quickly master MODE NAVI operation

The sensor's basic operations are represented by 6 indicators (MODE NAVI). The user can check what mode the sensor is presently in with a quick glance making operation simple.

This is the sensing mode. The digital display shows the light-receiving amount (mark mode) and the color consistency (color mode).

RUN

COLOR

This mode enables a mark mode / color mode selection.

This is the threshold value setting (teaching) mode.

TEACH

TIMER

Timer type selection mode.

This is the threshold fine-adjustment mode.

ADJ

PRO

This mode enables the setting of various functions such as key lock and timer period.

Sensing status digitally controllable

The sensing status, displayed numerically, can be verified at a glance. Also, the sensor settings for each type of packing film can be digitally indicated.

• Example of sensor setting indication

■ Selected LED: Red LED
■ Threshold value: 600

■ Selected LED: Green LED
■ Threshold value: 1850

■ Selected LED: Blue LED
■ Threshold value: 1600

Direct codes enable settings verification at a glance

The settings for the **LX-100** series sensors are displayed using a 4-digit direct code. Direct codes enable easy setting verification and maintenance by phone.

What is the direct code?

The direct code is 0004. At present, the sensor is operating with a mark at 2300 and base at 860.

Produkte, Support und Service

SENTRONIC AG

Direct code table (D-Code)

The sensor setting modes can be verified by a 4-digit code (D-Code). The table below shows a list of all available codes.

● When in RUN mode, press the MODE key for at least 2 sec. to display the direct code. (Remove your finger from the MODE key and the direct code will disappear.)

1st digit

Display	Sensing mode (light source color)	Operation mode (Note 1)	Sensing (Note 2)
0	Mark mode (green)	L-ON	FINE
1			COARSE
2		D-ON	FINE
3			COARSE
4	Mark mode (blue)	L-ON	FINE
5			COARSE
6		D-ON	FINE
7			COARSE
8	Mark mode (red)	L-ON	FINE
9			COARSE
A		D-ON	FINE
b			COARSE
c	Color mode	Consistent-ON	FINE
d			COARSE
E		Inconsistent-ON	FINE
F			COARSE

2nd digit

Display	Display mode	ECO mode (Note 4)	Turn mode (Note 5)
0	Standard	OFF	OFF
1			ON
2		ON	OFF
3			ON
4	Percent display (Note 3)	OFF	OFF
5			ON
6		ON	OFF
7			ON
8	—	—	—
9	—	—	—
A	—	—	—
b	—	—	—
c	—	—	—
d	—	—	—
E	—	—	—
F	—	—	—

3rd digit

Display	Key lock	Timer mode
0	Full lock (All operations disabled)	non
1		OFF-delay
2		ON-delay
3	RUN teaching (Teaching only enabled)	non
4		OFF-delay
5		ON-delay
6	RUN adjust (Threshold value adjustment only enabled)	non
7		OFF-delay
8		ON-delay
9	—	—
A	—	—
b	—	—
c	—	—
d	—	—
E	—	—
F	—	—

4th digit

Display	Timer period
0	1 ms
1	2 ms
2	5 ms
3	10 ms
4	20 ms
5	50 ms
6	100 ms
7	200 ms
8	500 ms
9	—
A	—
b	—
c	—
d	—
E	—
F	—

Notes: 1) In Mark mode, L-ON / D-ON is automatically set in the sensor. For example, with 2-level teaching, press the ON key at the targeted mark and press the OFF key at the base (non-mark area). When doing so, the operator does not have to consider L-ON / D-ON.
2) Sensing accuracy can be set to either FINE (standard) or COARSE.
3) The percent display is only enabled in mark mode.
4) ECO mode is a function that reduces power consumption by turning off the digital display in the event that no button operations are made for a predetermined time (approx. 10 sec. or more) in RUN mode. Press any button to turn the digital display on again.
5) The turn mode is a function that reverses the digital display making it easily to be viewed in the event that the sensor installation renders the display up-side-down.
* Default setting: D-code = " 0004 ".

Super simple teaching

Press the ON button at the targeted mark.

Here is an example of the most basic setting method "2-level teaching".

Mode selection — Press MODE key and select TEACH mode.

Teaching
❶ Align the spot on the mark and press the ON key.
❷ Align the spot onto the base (non-mark area) and press the OFF key.
* The ❶ ❷ order can be reversed.

◀ Display showing complete settings

Sensing — Teaching complete. The optimal LED is automatically selected and the sensor automatically returns to RUN mode.

Other teaching methods

• Full-auto teaching: In Mark mode, teaching is effective without stopping the sensing object.
• 1-level teaching: In Color mode, the color detected is aligned by the spot and teaching is effective.

External teaching possible

Teaching is possible through external input using an operation panel or touch panel even on hard-to-reach color mark sensors located inside an equipment. Also, models can be interchanged easily.

Mark mode
2-level teaching and full-auto teaching possible

Color mode
1-level teaching possible

Compact design for significant space savings

High precision sensing and multiple functions are all packed in a compact W57 × D24 × H38 mm W2.244 × D0.945 × H1.496 in body.
Cable and plug-in connector types are available depending on the equipment used. These sensors can be easily introduced to existing facilities.

38 mm
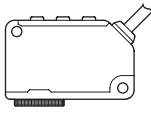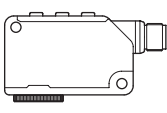1.496 in

24 mm
0.945 in

57 mm
2.244 in

Key lock function

The key lock function enables input operation control that prevents mistaken changes in the sensor settings. Other detailed settings include "RUN adjust", allowing threshold value adjustment only, and "RUN teaching", allowing teaching operation only.
If the sensor is set to "RUN adjust" or "RUN teaching", adjustment and teaching are possible having the sensor remained in RUN mode.

ORDER GUIDE

Sensors | Mating cable is not supplied with the plug-in connector type. Please order it separately.

Type	Appearance	Model No.	Output	Sensing range
Cable type		**LX-101**	NPN open-collector transistor	10 ±3 mm 0.394 ±0.118 in
Cable type		**LX-101-P**	PNP open-collector transistor	10 ±3 mm 0.394 ±0.118 in
Plug-in connector type		**LX-101-Z**	NPN open-collector transistor	10 ±3 mm 0.394 ±0.118 in
Plug-in connector type		**LX-101-P-Z**	PNP open-collector transistor	10 ±3 mm 0.394 ±0.118 in

Mating cables for plug-in connector type sensor | Mating cable is not supplied with the plug-in connector type sensor. Please order it separately.
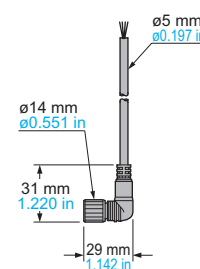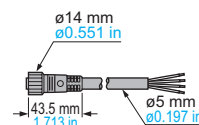
Type	Model No.	Description	
Straight	**CN-24B-C2**	Length: 2 m 6.562 ft	0.34 mm² 4-core cabtyre cable, with connector on one end Cable outer diameter: ø5 mm ø0.197 in
Straight	**CN-24B-C5**	Length: 5 m 16.404 ft	
Elbow	**CN-24BL-C2**	Length: 2 m 6.562 ft	
Elbow	**CN-24BL-C5**	Length: 5 m 16.404 ft	

Mating cables for plug-in connector type sensor

• **CN-24B-C2**   • **CN-24BL-C2**
• **CN-24B-C5**   • **CN-24BL-C5**

ø14 mm ø0.551 in
43.5 mm 1.713 in
ø5 mm ø0.197 in

ø5 mm ø0.197 in
ø14 mm ø0.551 in
31 mm 1.220 in
29 mm 1.142 in

OPTIONS

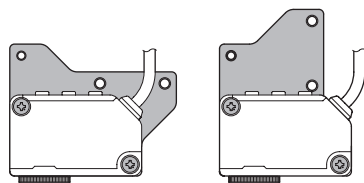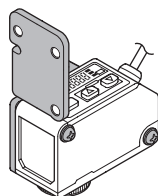| Type	Model No.	Description
Sensor mounting bracket	**MS-LX-1**	Mounting bracket made for **LX-100** series applicable for various kinds of installations
Sensor mounting bracket	**MS-LX-2**	Mounting bracket made for **LX-100** series applicable for various kinds of installations

Sensor mounting bracket

• **MS-LX-1**

Two M4 (length 28 mm 1.102 in) screws with washers are attached.

• **MS-LX-2**

Two M4 (length 30 mm 1.181 in) screws with washers are attached.

■ SPECIFICATIONS

	Type	Cable type	Plug-in connector type
Model No. — NPN output		**LX-101**	**LX-101-Z**
Item — PNP output		**LX-101-P**	**LX-101-P-Z**
Sensing range		10 ±3 mm 0.394 ±0.118 in	
Spot size		1 × 5 mm 0.039 × 0.197 in (at 10 mm 0.394 in setting distance)	
Supply voltage		12 to 24 V DC ±10 % Ripple P-P 10 % or less	
Current consumption		Normal mode: 750 mW or less (Current consumption 30 mA or less at 24 V supply voltage) ECO mode: 600 mW or less (Current consumption 25 mA or less at 24 V supply voltage)	
Output 1 (OUT)		\<NPN output type\> NPN open-collector transistor • Maximum sink current: 50 mA • Applied voltage: 30 V DC or less (between output and 0 V) • Residual voltage: 1.5 V or less (at 50 mA sink current) \<PNP output type\> PNP open-collector transistor • Maximum source current: 50 mA • Applied voltage: 30 V DC or less (between output and +V) • Residual voltage: 1.5 V or less (at 50 mA source current)	\<NPN output type\> NPN open-collector transistor • Maximum sink current: 100 mA • Applied voltage: 30 V DC or less (between output and 0 V) • Residual voltage: 1.5 V or less (at 100 mA sink current) \<PNP output type\> PNP open-collector transistor • Maximum source current: 100 mA • Applied voltage: 30 V DC or less (between output and +V) • Residual voltage: 1.5 V or less (at 100 mA source current)
	Short-circuit protection	Incorporated	
	Output operation	Mark mode: Light-ON / Dark-ON (Auto-setting on teaching), Color mode: Consistent-ON / Inconsistent-ON (Setting on teaching)	
Output 2 (OUT)		\<NPN output type\> NPN open-collector transistor • Maximum sink current: 50 mA • Applied voltage: 30 V DC or less (between output and 0 V) • Residual voltage: 1.5 V or less (at 50 mA sink current) \<PNP output type\> PNP open-collector transistor • Maximum source current: 50 mA • Applied voltage: 30 V DC or less (between output and +V) • Residual voltage: 1.5 V or less (at 50 mA source current)	———
	Short-circuit protection	Incorporated	———
	Output operation	Inverted operation of the output 1	———
Response time		Mark mode: 45 µs or less, Color mode: 150 µs or less	

Teaching input		\<NPN output type\>
		NPN non-contact input
		 • Signal condition: High… +5 V to +V, or open
		    Low… 0 to +2 V
		    (source current: 0.5 mA or less)
		 • Input impedance: 10 kΩ approx.
			\<PNP output type\>
			PNP non-contact input
			 • Signal condition: High… +4 V to +V
			    (sink current: 3 mA or less)
			    Low… 0 to +0.6 V, or open
			 • Input impedance: 10 kΩ approx.

Digital display		4-digit red LED display	
Sensitivity setting		Mark mode: 2-level teaching / Full-auto teaching, Color mode: 1-level teaching	
Fine sensitivity adjustment function		Incorporated	
Timer function		Incorporated with variable ON-delay / OFF-delay timer, switchable either effective or ineffective (Timer period: 1 to 500 ms, 9 levels variable)	
Environmental resistance — Protection		IP67 (IEC)	
Environmental resistance — Ambient temperature		−10 to +55 °C +14 to +131 °F (No dew condensation or icing allowed), Storage: −20 to +70 °C −4 to +158 °F	
Environmental resistance — Ambient humidity		35 to 85 % RH, Storage: 35 to 85 % RH	
Environmental resistance — Ambient illuminance		Incandescent light: 3,000 ℓx at the light-receiving face	
Environmental resistance — Voltage withstandability		1,000 V AC for one min. between all supply terminals connected together and enclosure	
Environmental resistance — Vibration resistance		10 to 500 Hz frequency, 3.0 mm 0.118 in amplitude (max. 20 G) in X, Y and Z directions for two hours each	
Environmental resistance — Shock resistance		500 m/s² acceleration (50 G approx.) in X, Y and Z directions for three times each	
Emitting element		Combined Red / Green / Blue LEDs (Peak emission wavelength: 640 nm 0.025 mil / 525 nm 0.021 mil / 470 nm 0.019 mil)	
Material		Enclosure: PBT, Display cover: Polycarbonate, Operation buttons: Silicone rubber, Lens: Glass, Lens holder: Aluminum	
Cable		0.34 mm² 5-core cabtyre cable, 2 m 6.562 ft long	(Note 2)
Cable extension		Extension up to total 100 m 328.084 ft is possible with 0.3 mm², or more, cable.	
Weight		Net weight: 120 g approx., Gross weight: 180 g approx.	Net weight: 55 g approx., Gross weight: 120 g approx.
Accessory		M4 (length 30 mm 1.181 in) screw with washers: 2 pcs.	

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.
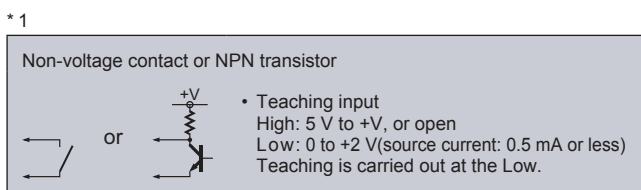 2) Mating cable is not supplied with the plug-in connector type. Please order it separately.

I/O CIRCUIT AND WIRING DIAGRAMS

LX-101(-Z) — NPN output type

I/O circuit diagram

Terminal No. of plug-in connector type — Color code of cable type / mating cable for plug-in connector type

- ① (Brown) +V
- ④ (Black) Output 1
- (White) Output 2 (Note 2) 50 mA max. (Note 1)
- 50 mA max. (Note 1)
- ② (Pink) Teaching input
- ③ (Blue) 0 V

12 to 24 V DC ±10 %

D_1, Tr_1, Tr_2, $+5$ V, Z_{D2}, Z_{D1}, 10 kΩ, D_2

Internal circuit ← → Users' circuit
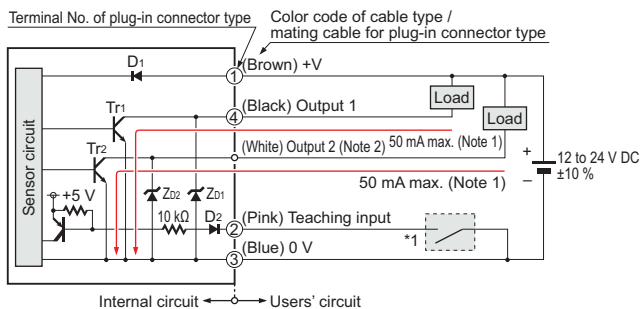
Notes: 1) The current of the plug-in connector type **LX-101-Z** is 100 mA max.
2) The output 2 is not incorporated to the plug-in connector type **LX-101-Z**.

*1

Non-voltage contact or NPN transistor

+V

or

- Teaching input
  High: 5 V to +V, or open
  Low: 0 to +2 V(source current: 0.5 mA or less)
  Teaching is carried out at the Low.

Symbols … D_1, D_2 : Reverse supply polarity protection diode
Z_{D1}, Z_{D2}: Surge absorption zener diode
Tr_1, Tr_2 : NPN output transistor

LX-101-P(-Z) — PNP output type

I/O circuit diagram

Terminal No. of plug-in connector type — Color code of cable type / mating cable for plug-in connector type

- ① (Brown) +V
- ② (Pink) Teaching input
- 50 mA max. (Note 1)
- ④ (Black) Output 1 50 mA max. (Note 1)
- (White) Output 2 (Note 2)
- ③ (Blue) 0 V

12 to 24 V DC ±10 %

0 V, 10 kΩ, D_2, Z_{D1}, Z_{D2}, Tr_1, Tr_2, D_1
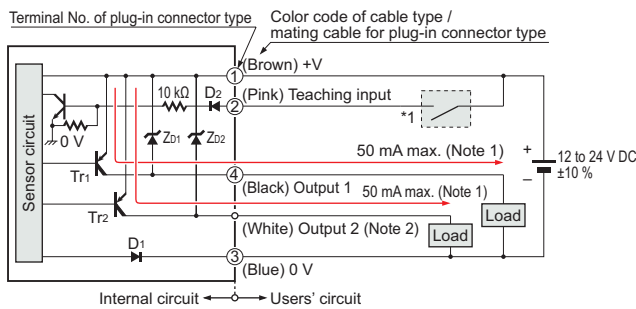
Internal circuit ← → Users' circuit

Notes: 1) The current of the plug-in connector type **LX-101-P-Z** is 100 mA max.
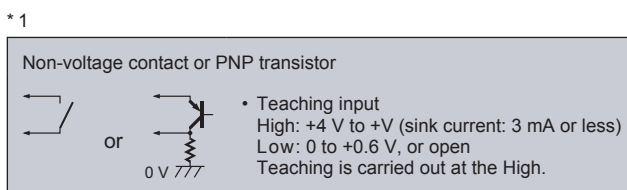2) The output 2 is not incorporated to the plug-in connector type **LX-101-P-Z**.

*1

Non-voltage contact or PNP transistor

or

0 V

- Teaching input
  High: +4 V to +V (sink current: 3 mA or less)
  Low: 0 to +0.6 V, or open
  Teaching is carried out at the High.

Symbols … D_1, D_2 : Reverse supply polarity protection diode
Z_{D1}, Z_{D2}: Surge absorption zener diode
Tr_1, Tr_2 : PNP output transistor

Connector pin layout of plug-in connector type
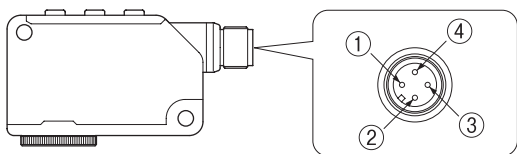
Connector pin No.	Description
①	+V
②	Teaching input
③	0 V
④	Output

SPOT SIZE CHARACTERISTICS (TYPICAL)

(Unit: mm in)

Setting distance L (Note 1)	Spot size (Note 2)	
	Width (W)	Length (D)
7 0.276	2.0 0.079	5.5 0.217
8 0.315	1.7 0.067	5.5 0.217
9 0.354	1.2 0.047	5.3 0.209
10 0.394	1.0 0.039	5.0 0.197
11 0.433	1.3 0.051	5.0 0.197
12 0.472	1.5 0.059	5.0 0.197
13 0.512	2.0 0.079	5.0 0.197

Notes: 1) Setting distance "L" represents the distance from the lens surface to the sensing object.
2) Examples only meant for use as a guideline.

■ PRECAUTIONS FOR PROPER USE

⚠️
- Never use this product as a sensing device for personnel protection.
- In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

Mounting

- Care must be taken regarding the sensor mounting direction with respect to the object's direction of movement.
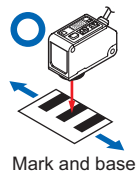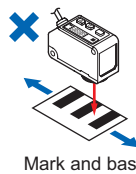

Mark and base   Mark and base

Do not make the sensor detect an object in this direction because it may cause unstable operation.

- The tightening torque should be 0.8 N·m or less.

Sensing glossy object

- Objects with a glossy surface have a large amount of specular reflection particles that may destabilize sensing. In such a case, by slightly tilting the sensor's beam axis, this specular reflection can be reduced rendering sensing more stable.
- If the surface of the sensing object has a shine, mount the sensor inclining approx. 10 to 15 degrees against the sensing object.
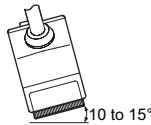
10 to 15°

Wiring

- Make sure to carry out wiring in the power supply off condition.
- Take care that wrong wiring will damage the sensor.
- Verify that the supply voltage variation is within the rating.
- Take care that if a voltage exceeding the rated range is applied, or if an AC power supply is directly connected, the sensor may get burnt or damaged.
- In case noise generating equipment (switching regulator, inverter motor, etc.) is used in the vicinity of this product, connect the frame ground (F.G.) terminal of the equipment to an actual ground.
- If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- Take care that short-circuit of the load or wrong wiring may burn or damage the sensor.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.
- Extension up to total 100 m is possible with 0.3 mm², or more, cable. However, in order to reduce noise, make the wiring as short as possible.

Others

- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- Take care that the sensor is not directly exposed to fluorescent light from a rapid-starter lamp or a high frequency light device or sunlight etc., as it may affect the sensing performance.
- Do not touch the lens of the sensor by hand directly. If the lens becomes dirty, wipe it off with a soft cloth gently.
- When the inside lens is steamed up, unscrew the lens to get rid of the condensation.
- These sensors are only for indoor use.
- Do not use this sensor in places having excessive vapor, dust, etc., or where it may come in direct contact with water, or corrosive gas.
- Take care that the product does not come in contact with water, oil, grease, or organic solvents, such as, thinner, etc.
- Make sure that stress by forcible bend or pulling with 76 N, or more, force is not applied to the sensor cable joint.
- This sensor cannot be used in an environment containing inflammable or explosive gases.
- Never disassemble or modify the sensor.

■ LIST OF PROMODE SETTING ITEMS

• Before performing teaching or each detail setting, perform the setting of either mark mode or color mode with mark / color mode setting of NAVI mode.

NAVImode

RUN | Run
At mark mode setting: Indicates the absolute value of emitting amount. It is possible to indicate the relative value (percent value) against threshold value.
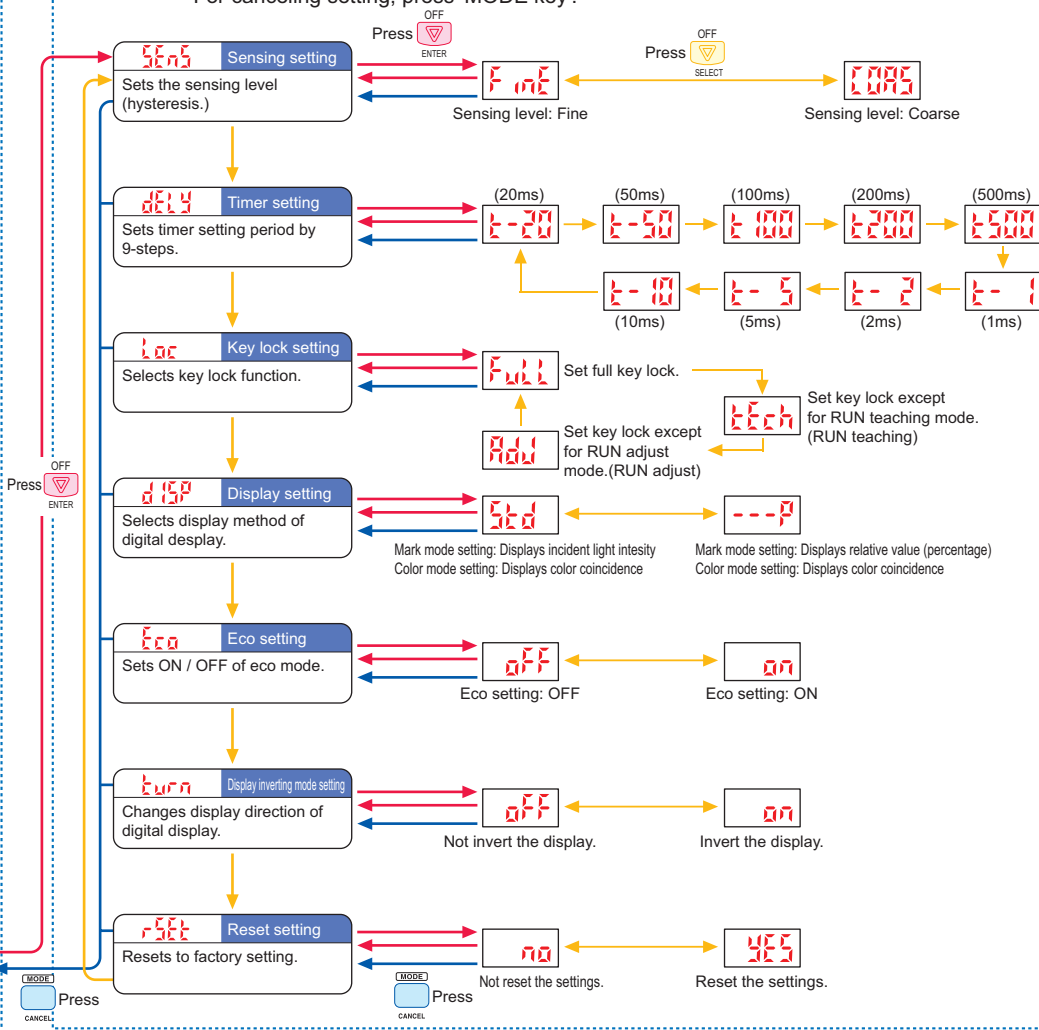**At color mode setting:** Indicates color matching degree with relative value.

Press

TEACH | Teaching
At mark mode setting: Sets the threshold value by '2-level teaching' or 'full-auto teaching'.
At color mode setting: Sets the threshold value by '1-level teaching'.

ADJ | Adjust
At mark mode setting: Allows fine adjustment of the threshold value.
At color mode setting: Allows adjustment of sensing tolerance value.

COLOR | Mark / Color mode setting
Sets mark mode or color mode.

TIMER | Timer operation setting
Configures operation of the timer.

PRO | PRO
Allows various detailed settings to be configured.

Press MODE CANCEL

PROmode • For selecting a setting item, press 'ON key'. For confirming each selected setting item, press 'OFF / ENTER key'. After confirming setting, the digital display flashes. For canceling setting, press 'MODE key'.

Press OFF ENTER

5En5 | Sensing setting
Sets the sensing level (hysteresis.)

Press OFF SELECT

FinE Sensing level: Fine ↔ **CoAr5** Sensing level: Coarse

dELY | Timer setting
Sets timer setting period by 9-steps.

(20ms) **t-20** → (50ms) **t-50** → (100ms) **t 100** → (200ms) **t200** → (500ms) **t500**

(10ms) **t- 10** ← (5ms) **t- 5** ← (2ms) **t- 2** ← (1ms) **t- 1**

Loc | Key lock setting
Selects key lock function.

FuLL Set full key lock.
tEch Set key lock except for RUN teaching mode. (RUN teaching)
AdJ Set key lock except for RUN adjust mode.(RUN adjust)

diSP | Display setting
Selects display method of digital desplay.

Std ↔ **---P**
Mark mode setting: Displays incident light intesity
Color mode setting: Displays color coincidence
Mark mode setting: Displays relative value (percentage)
Color mode setting: Displays color coincidence

Eco | Eco setting
Sets ON / OFF of eco mode.

oFF Eco setting: OFF ↔ **on** Eco setting: ON

turn | Display inverting mode setting
Changes display direction of digital display.

oFF Not invert the display. ↔ **on** Invert the display.

r5Et | Reset setting
Resets to factory setting.

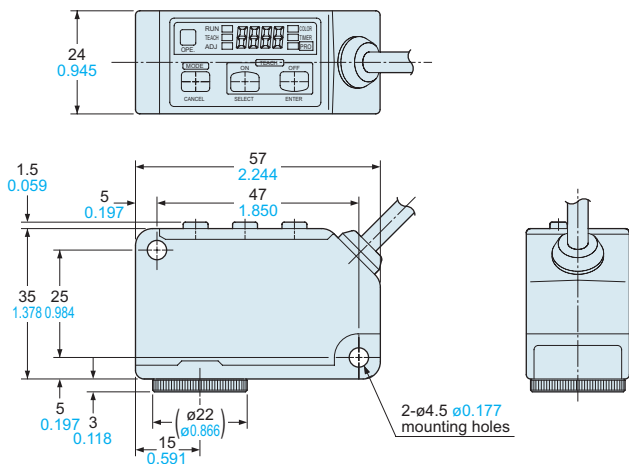**no** Not reset the settings. ↔ **YES** Reset the settings.

Press MODE CANCEL

■ DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.

LX-101 LX-101-P — Sensor

24
0.945

1.5
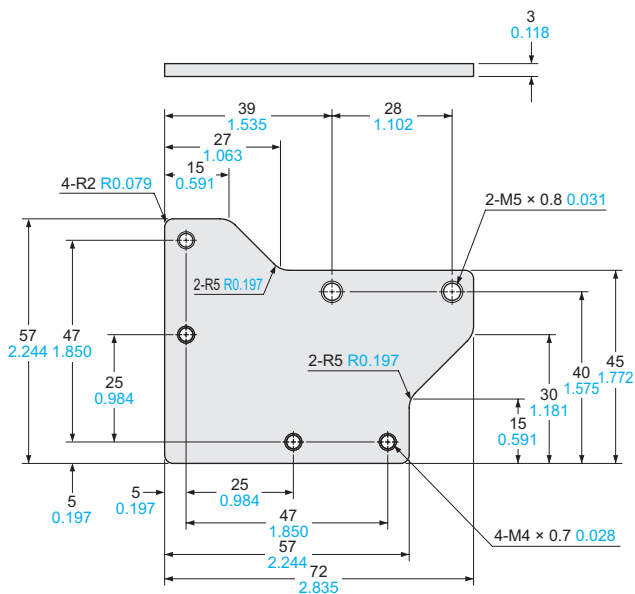0.059

5
0.197

57
2.244

47
1.850

35
1.378

25
0.984

5
0.197

3
0.118

15
0.591

(ø22
ø0.866)

2-ø4.5 ø0.177
mounting holes

LX-101-Z LX-101-P-Z — Sensor

24
0.945

1.5
0.059

5
0.197

71.5
2.815

57
2.244

47
1.850

35
1.378

25
0.984

5
0.197

3
0.118

15
0.591

(ø22
ø0.866)

2-ø4.5 ø0.177
mounting holes

ø14.4
ø0.567

9.4
0.370

M12

MS-LX-1 — Sensor mounting bracket (Optional)

3
0.118

39
1.535

28
1.102

27
1.063

15
0.591

4-R2 R0.079

2-M5 × 0.8 0.031

2-R5 R0.197

2-R5 R0.197

57
2.244

47
1.850

25
0.984

5
0.197

5
0.197

25
0.984

47
1.850

57
2.244

72
2.835

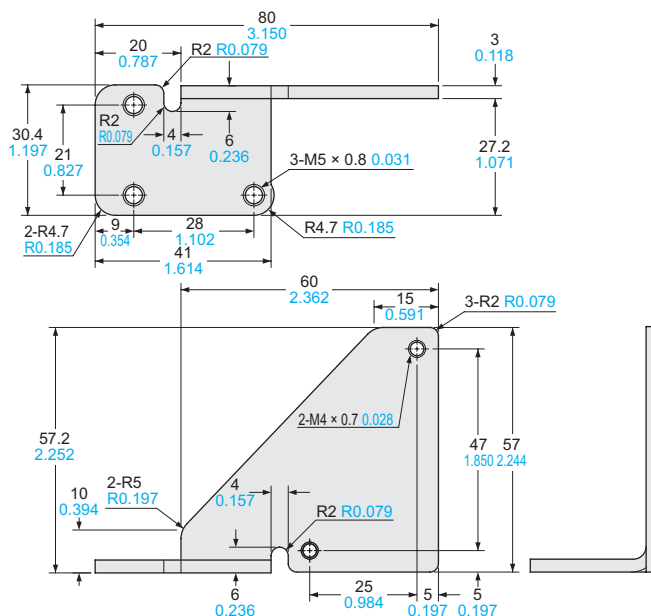45
1.772

40
1.575

30
1.181

15
0.591

4-M4 × 0.7 0.028
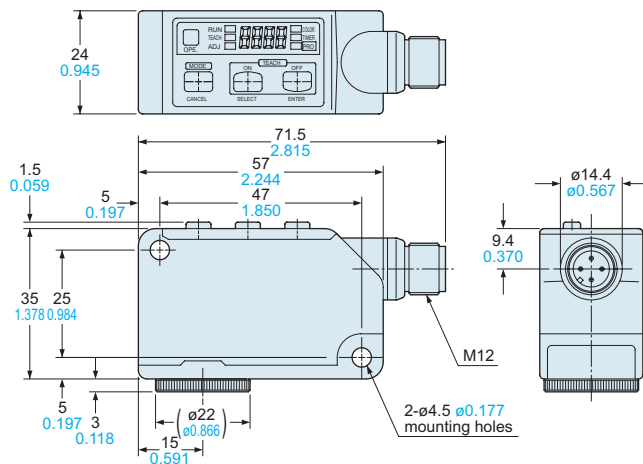
Material: Stainless steel (SUS)

Two M4 (length 28 mm 1.102 in) screws with washers are attached.

MS-LX-2 — Sensor mounting bracket (Optional)

80
3.150

20
0.787

R2 R0.079

3
0.118

30.4
1.197

R2
R0.079

21
0.827

4
0.157

6
0.236

3-M5 × 0.8 0.031

27.2
1.071

2-R4.7
R0.185

9
0.354

28
1.102

41
1.614

R4.7 R0.185

60
2.362

15
0.591

3-R2 R0.079

57.2
2.252

2-M4 × 0.7 0.028

10
0.394

2-R5
R0.197

4
0.157

R2 R0.079

47
1.850

57
2.244

6
0.236

25
0.984

5
0.197

5
0.197

Material: Stainless steel (SUS)

Two M4 (length 30 mm 1.181 in) screws with washers are attached.