


Photo-electric sensors - Miniature design

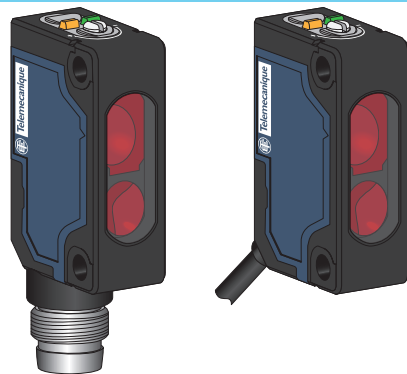


NPN - M8 Connector : XUM4ANXB8
XUM5ANXB8
XUM6ANXB8

PNP - M8 Connector : XUM4APXB8
XUM5APXB8
XUM6APXB8




NPN - 2 m Cable : XUM4ANXBL2
XUM5ANXBL2
XUM6ANXBL2

PNP - 2 m Cable : XUM4APXBL2
XUM5APXBL2
XUM6APXBL2



Model	Sensing distance D
XUM4A●	0,25 m / 0.82 ft
XUM5A●	1,9 m / 6.23 ft
XUM6A●	1,1 m / 3.61 ft

Diffuse

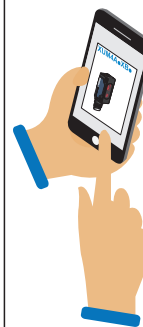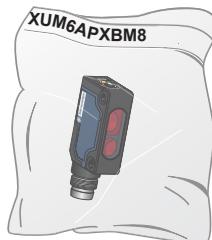Package Content
(Example)

<http://qr.tesensors.com/XU0007>

Scan the QR-code to access this Instruction Sheet in different languages or you can download this from our website at: **www.tesensors.com**

We welcome your comments about this document. You can reach us through the customer support page on your local website.

⚡ DANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

- Disconnect all power before servicing equipment.
- Do not connect this device to AC power.
- The power voltage must not exceed the rated range.

Failure to follow these instructions will result in death or serious injury.


⚠ WARNING

IMPROPER SETUP OR INSTALLATION

- This equipment must only be installed and serviced by qualified personnel.
- Read, understand, and follow the compliance below, before installing the XUM Photo-electric sensor.
- Do not tamper with or make alterations on the unit.
- Comply with the wiring and mounting instructions.
- Check the connections and fastening during maintenance operations.
- The proper functioning of the XUM photoelectric sensor and its operating line must be checked regularly and according to the application (for example number of operations, level of environmental pollution, etc.).


Failure to follow these instructions can result in death, serious injury, or equipment damage.

Mounting and tightening torques

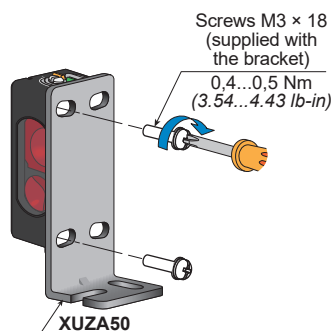


0,4...0,5 Nm
(3.54...4.43 lb-in)

CAUTION
UNINTENDED EQUIPMENT OPERATION
Do not apply excessive impact on the sensor during the installation process, so as to prevent damage or deterioration in the degree of protection.
Failure to follow these instructions can result in injury or equipment damage.

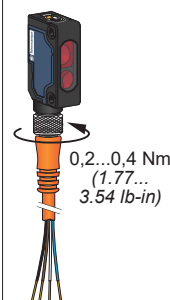




0,2...0,4 Nm
(1.77... 3.54 lb-in)

LEDs and settings


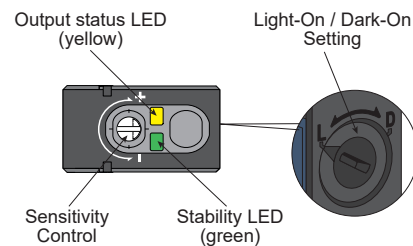


Wiring diagrams


M8 Metal Connector - 4 pins

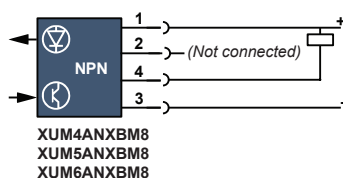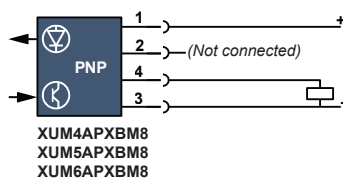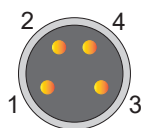

2 m Cable - 3 wires

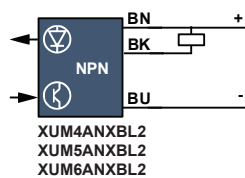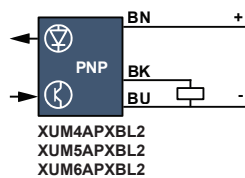

Wiring precaution

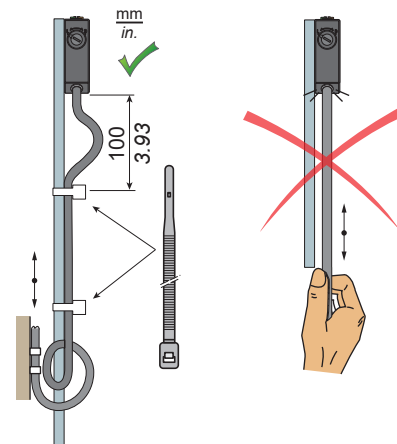

NOTICE

UNINTENDED EQUIPMENT OPERATION

Do not pull on the sensor cable so as to prevent damage or deterioration in the degree of protection

Failure to follow these instructions can result in equipment damage.



Electrical equipment should be installed, operated and maintained only by qualified personnel.
No responsibility is assumed by Schneider Electric for any consequences arising out of the use of this material.

© 2021 Schneider Electric. "All Rights Reserved."


Dimensions

mm
in.


1 mm = 0.0397 in.

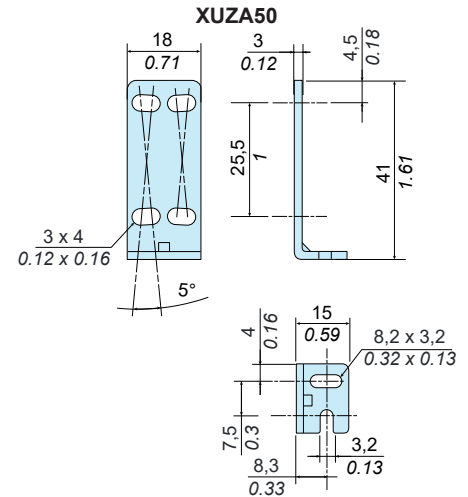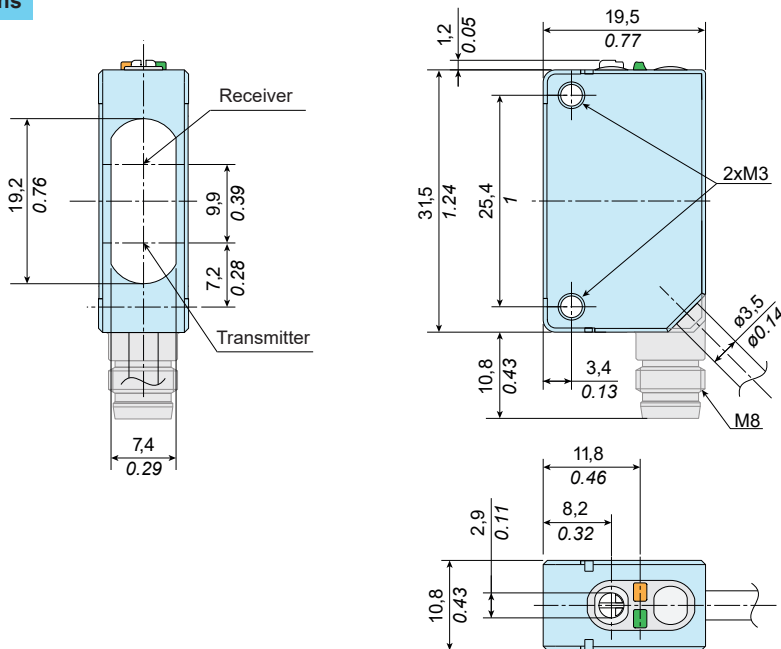


XUZASM04

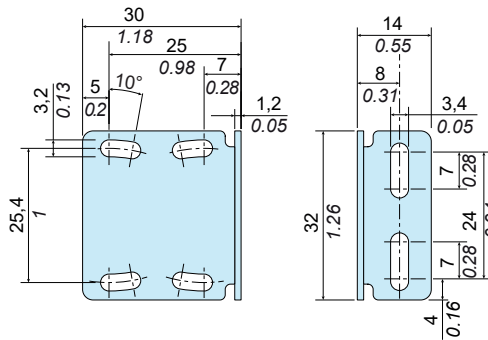

XUZASM02

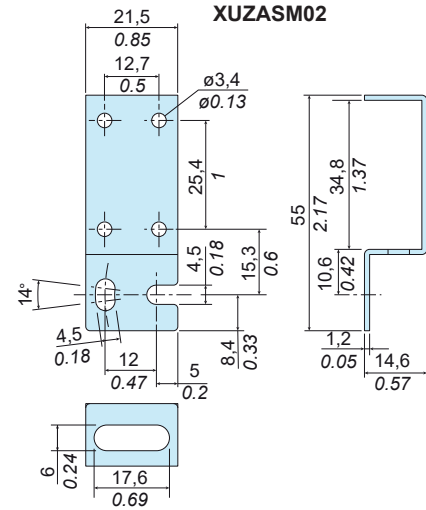


XUZASM03


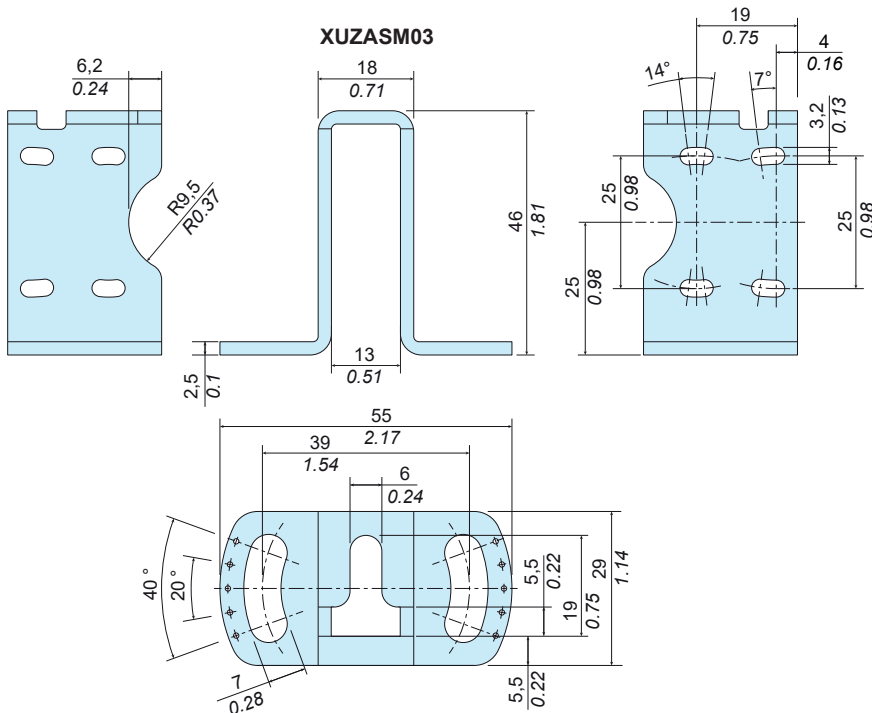


Accessories



Mounting brackets (to order separately)

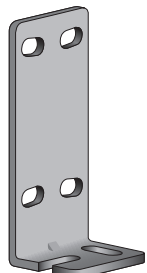



XUZA50

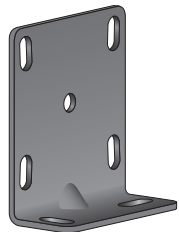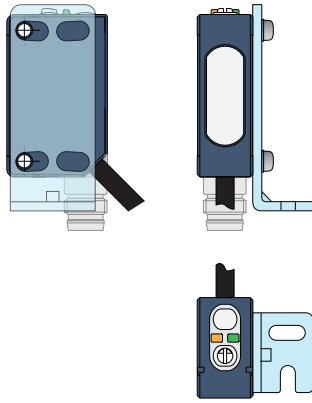


XUZASM04

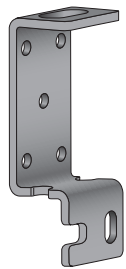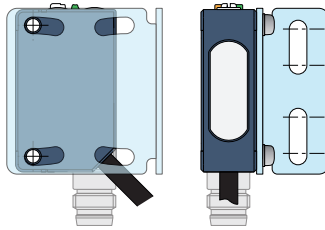

XUZASM02

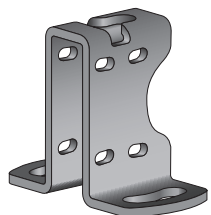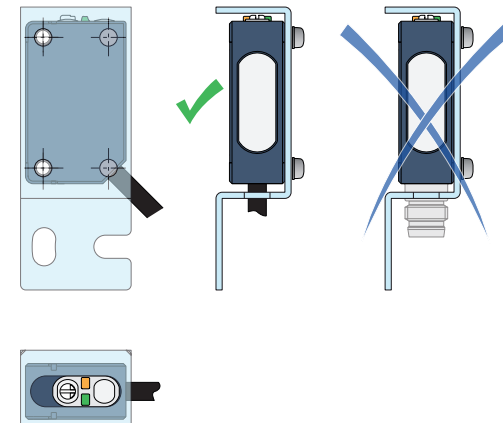

XUZASM03

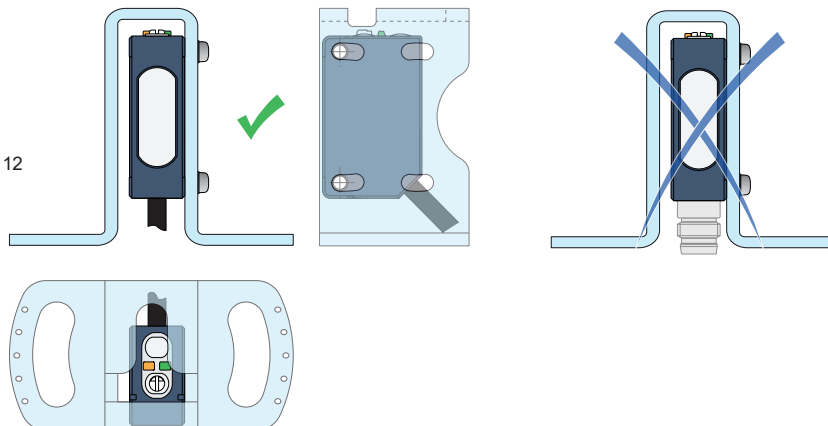


Pre-wired connectors (examples)


PVC cable for general use
PUR cable for severe industrial environments

M8, 4 pins					M8 - M12, 4 pins		
	PVC	PUR	PVC	PUR		PUR	PUR
Cable length					Jumper length		
2 m / 6.56 ft.	XZCPV0941L2	XZCP0941L2	XZCPV1041L2	XZCP1041L2	1 m / 3.28 ft.	XZCR1509041J1	XZ CR1510041J1
5 m / 16.4 ft.	XZCPV0941L5	XZCP0941L5	XZCPV1041L5	XZCP1041L5	2 m / 6.56 ft.	XZCR1509041J2	XZCR1510041J2
10 m / 32.8 ft.	XZCPV0941L10	XZCP0941L10	XZCPV1041L10	XZCP1041L10			

Sensors position adjustment


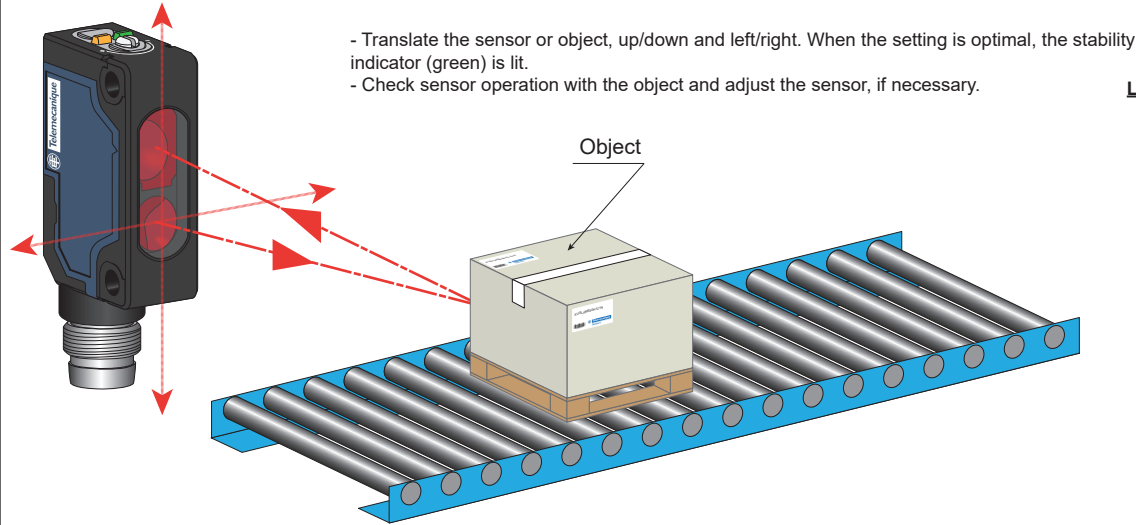


LED status with LO output function

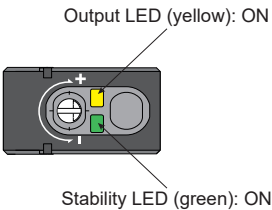


Anti-interference for side by side mounting

Anti-interference system to ensure good detection even disturbed by another sensor when mounted side by side

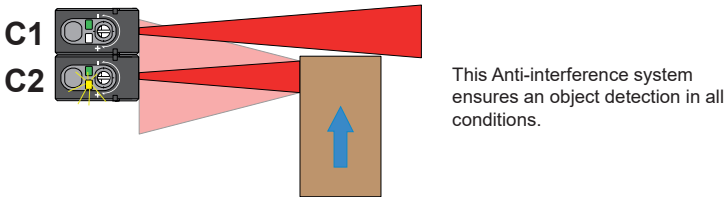

Output mode setting: Light-On or Dark-On (Light-On by default)

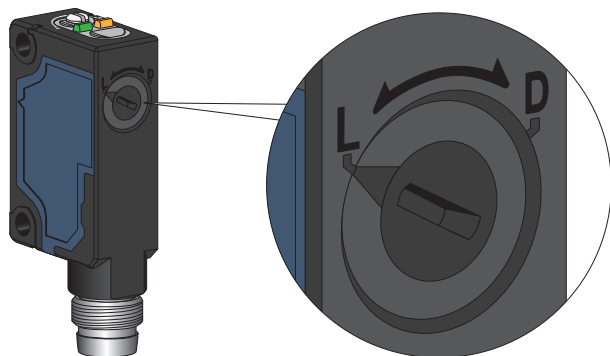

Light-On / Normally Open	Dark-On / Normally Closed
The Output is OFF	The Output is ON
The Output is ON	The Output is OFF

Sensor sensitivity adjustment

For an accurate detection, follow the set up below. (eg. Dark objects, with holes or with small size to reflect properly the light beam).


	Light-On	Dark-On
0,8 x 4 mm / 0.03 x 0.16 in.	1-Connect the sensor to the power supply (see page 1 for the wire connection & page 7 for the power voltage). Before settings, start with the potentiometer at the minimum position (resulting to point A).	1-Connect the sensor to the power supply (see page 1 for the wire connection & page 7 for the power voltage). Before settings, start with the potentiometer at the minimum position (resulting to point A).
Object position Object	2-Put the object in front of the sensor. Turn clockwise the potentiometer until the output led (yellow) switches on (resulting to point B).	2-Put the object in front of the sensor. Turn clockwise the potentiometer until the output led (yellow) switches off (resulting to point B).
Correct settings Object	3-For a stable detection, turn the potentiometer clockwise until the stability led (green) switches on & the output led (yellow) remained on (resulting to point C).	3-For a stable detection, turn the potentiometer clockwise until the stability led (green) switches on & the output led (yellow) remained off (resulting to point C).
Object	4-The Sensor is set and ready to detect	4-The Sensor is set and ready to detect

Detection curves

XUM4: Diffuse reflective (0,25 m) - Object size / Sensing distance

XUM5: Diffuse reflective (1,9 m) - Object size / Sensing distance


XUM6: Diffuse reflective (1,1 m) - Object size / Sensing distance

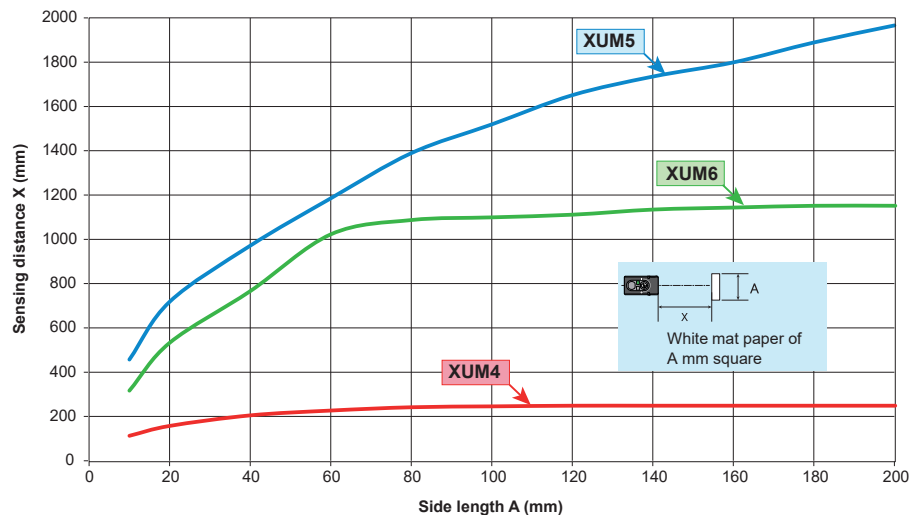

XUM4: Diffuse reflective (0,25 m) - Lateral displacement

XUM5: Diffuse reflective (1,9 m) - Lateral displacement


XUM6: Diffuse reflective (1,1 m) - Lateral displacement

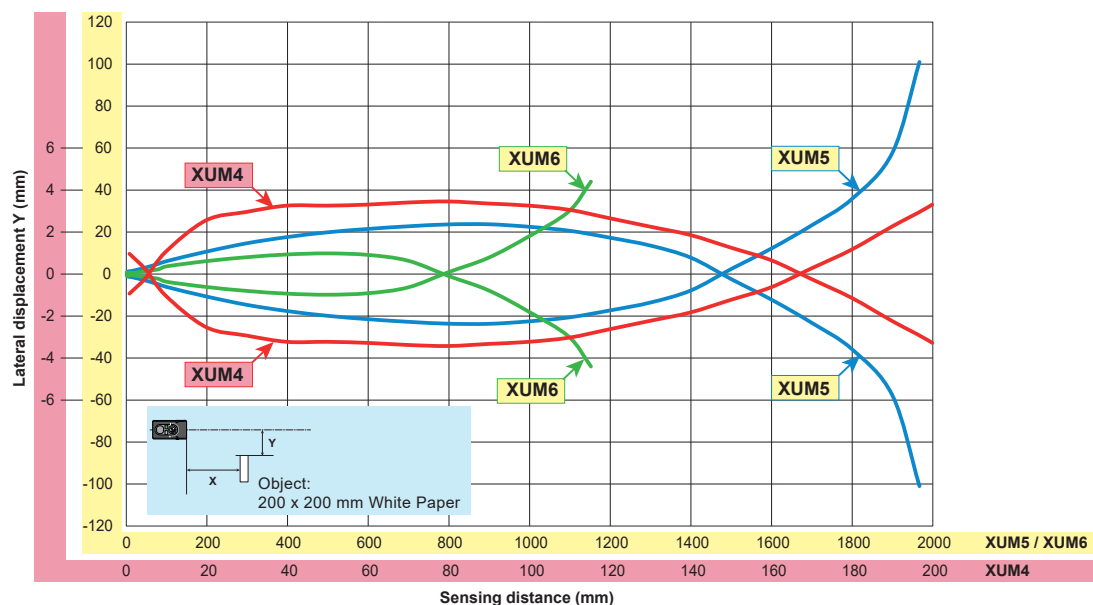

XUM4: Diffuse reflective (0,25 m) - Excess gain

XUM5: Diffuse reflective (1,9 m) - Excess gain

XUM6: Diffuse reflective (1,1 m) - Excess gain

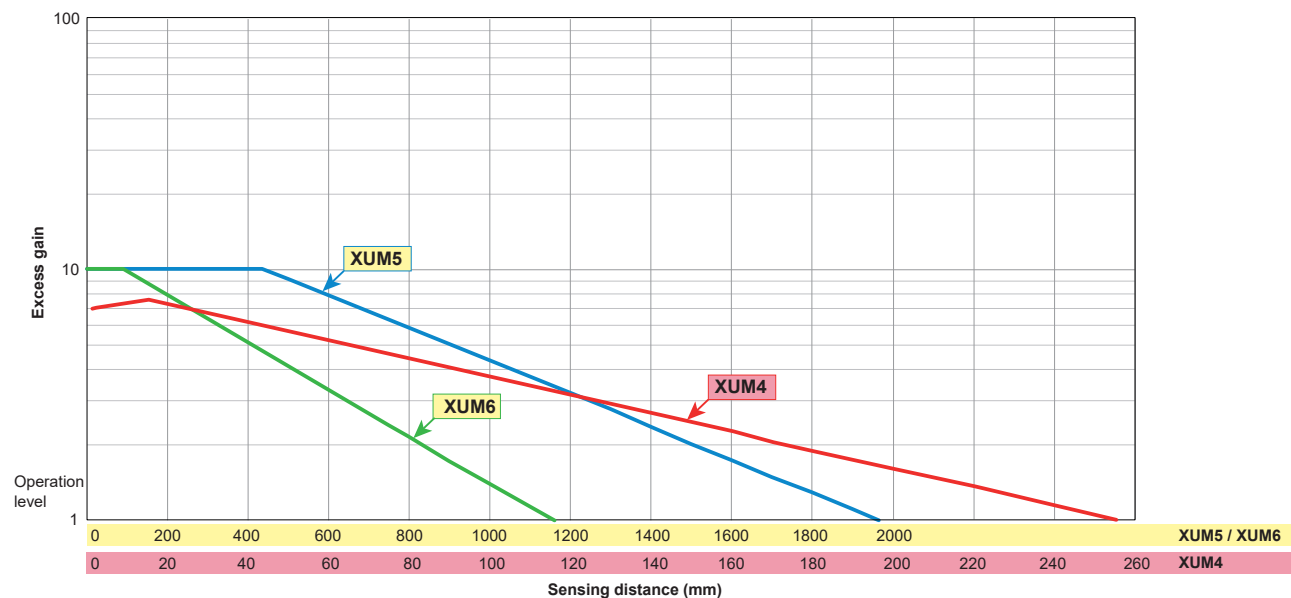

Characteristics

1 mm = 0.0397 in.

Certification	CE - UKCA - cULus
Sensing Range (using a white paper 200 x 200) Max. sensing distance (excess gain=1)	XUM5: 1,9 m - excess gain =1 1,5 m - excess gain=2 XUM6: 1,1 m - excess gain =1 0,8 m - excess gain=2 XUM4: 0,25 m - excess gain =1 0,17 m - excess gain=2
Color of detection light beam	XUM6: Red - XUM5 / XUM4: Infrared
Blind zone	XUM4 / XUM5 / XUM6: 10 mm
Hysteresis	2% < H < 20% (at most sensitivity, white paper)
Sensing distance setting	Potentiometer 1 turn (~ 240 degrees)
Light-On/Dark-On selection	Switch (~ 120 degrees)
Output type	PNP or NPN
ON Voltage drop	2 V max. (30 Vdc 100 mA) / 1,2 V max. (30 Vdc 10mA)
Current consumption	< 20 mA max.
Switching capacity	100 mA
Response time	0,5 ms max.
Recovery time	0,5 ms max.
Switching frequency	1000 Hz
Electrostatic discharge immunity	4 kV (Contact), 8 kV (Air) conforming to IEC 61000-4-2
Electromagnetic field immunity	10 V/m conforming to IEC 61000-4-3
Fast transients immunity	Burst 5 kHz - 2kV conforming to IEC 61000-4-4
Conducted disturbances immunity	10 V conforming to IEC 61000-4-6
Emissivity Radiated disturbances	Class A conforming to EN 55011 / CISPR 11
Power Voltage	Rated operational voltage: 12...24 Vdc Ripple p-p 10% maximum Operating range: 10...30 Vdc (including ripple) 
Product protection	Power supply : Reverse polarity protection Output: Short circuit protection Reverse polarity protection
Light Immunity	Operating atmosphere; Sunlight 40 kLx max. Incandescent light 10 kLx max.
Ambient Temperature	Operating : - 30...+55 °C (-22...+131 °F), Storage : - 40...+70 °C (-40...+158 °F)
Ambient Humidity	Operating : 35...95% RH, Storage : 35...95% RH
Degree of protection	IP65, IP67 conforming to EN/IEC 60529
Vibration resistance	Frequency range: 10 Hz to 500 Hz Acceleration: 9 g _n
Shock resistance	Peak acceleration: 100 g _n Duration of the pulse: 11 ms
Material	Housing: PBT, Lens: PMMA, Operation cover: PC, Adjustment potentiometer: PBT

