Safety Laser Scanner Type 3

SD3-A1

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC **SENSORS**

AREA SENSORS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY **SENSORS**

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

ENDOSCOPE

LASER MARKERS

PLC / TERMINALS

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION

UV CURING SYSTEMS

Single Beam Sensor Light Curtains

Control Units Optical Touch

Switch Definition of Sensing Heights

SD3-A1

Related Information ■ General terms and conditions...... F-17 ■ General precautions P.1405





FDA

Conforming to FDA regulations







This product is classified as a Class 1 Laser Product in IEC / JIS standards and in FDA regulations (21 CFR 1040.10 and 1040.11). Do not look at the laser beam through optical system such as a lens.

Monitor dangerous areas for unauthorized entry using flexible detection zones!

OPERATING PRINCIPLE

The safety laser scanner is used as an interlock that checks the reflection of the emitted laser and permits machine operation only when a person or an object is not present. Because it performs monitoring using invisible light, it is effective in wide areas that could not be enclosed by a safety fence or locations that become less efficient for work when they are concealed by a door or cover.

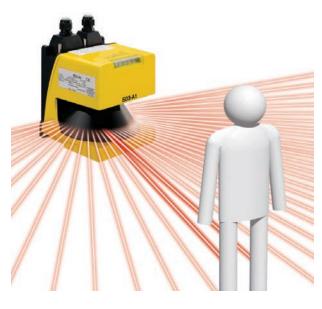

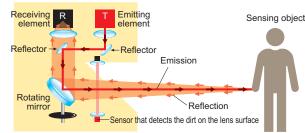

A pulsed laser beam is discharged from the emitting element (T) to the reflectors and onto a rotating mirror. The rotating mirror scans the laser as it rotates. The diffuse reflection from the sensing object is then returned to the receiving element (R) by means of the rotating mirror. The location of the sensing object is measured based on the travel time of the laser and the angular information of the rotating mirror. The monitoring area of max. 190° is divided into 528 segments (each 0.36°) by the rotating mirror.

Selec

Single Senso Light Contr

Switc


APPLICATIONS

Detecting entry into dangerous areas at processing machines Warning and machine halt zones are implemented to detect workers in dangerous areas.




Confirming safety around automatic guided vehicles

The scanner is used to slow down the speed of the vehicle upon detection at the warning zone and stop the vehicle upon entering the detection zone.

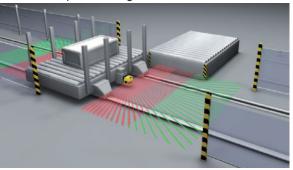

Detecting presence in a defined field

Install two safety laser scanners to build a detection zone that surrounds the monitoring object. Deactivation of detection is also possible by the flexible zone configuration.

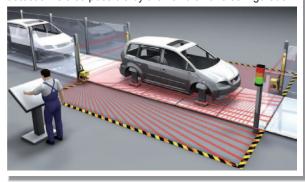


Detecting entry into dangerous areas of circular cycle tables One safety laser scanner can safeguard the front opening, where in the past two sets of light curtains were needed.



Freely configurable zones

Two zones can be widely monitored with the **SD3-A1**, the warning zone (within a radius 15 m 49.213 ft) and the detection zone (protection zone) (within a radius 4 m 13.123 ft). The contours of these zones are fully configurable for a perfect fit in every application. Up to eight zone patterns can be set and switched over at any given time, even during operation.

Flexible zone configuration by PC

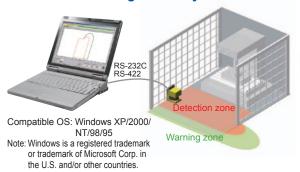

Measurement zone, radius 50 m 164.042 ft

Warning zone, max. radius 15 m 49.213 ft


Detection zone (protection zone),

Within individual semicircles, set monitoring contours based on the installation space.


Detection zone: Instantly stops the machine upon intrusion (control output)


Warning zone: Releases warning upon intrusion (warning output)

Up to 8 freely switchable zone patterns



Zone No.1 (example)









Zone No.8 (fixed)
Detection deactivated

Zone No.2 (example)

Zone No.3 (example) • • No.7

FIBER SENSORS

LASER

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

> AREA SENSORS

LIGHT CURTAINS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

ENDOSCOPE

LASER MARKERS

PLC / TERMINALS

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION

SYSTEMS

UV CURING SYSTEMS

Selection

Single Beam Sensor

Light Curtains

Control Units

Optical Touch Switch Definition of Sensing Heights

SD3-A1


Compact size

Compact size of W140 × H195 × D135 mm W5.512 × H7.677 × D5.315 in



Monitors beam misalignment after installation of safety laser scanner

By activating the reference boundary function which enables constant detection of stationary objects, the safety laser scanner memorizes the position of stationary objects, and monitors for beam misalignment after installation.

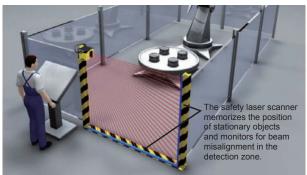

Prevents malfunctions caused by insects and dust

The safety laser scanner eliminates small insects and dust through it unique algorithm, "dust suppression function".

Adjustment of response times enables interference prevention

The response time is adjustable within the range from 80 to 640 ms. When setting up multiple safety laser scanners in close vicinity, mutual interference can be prevented by adjusting the response time.

Memorized configurations make post-maintenance recovery easy (Optional)

Configurations can be saved in the optional configuration plug which has a built-in memory. Even after maintenance or interchanging of safety laser scanners, the configurations from the memory in the plug can be easily loaded and recovered without the need to configure through a PC.



ORDER GUIDE

Designation	Appearance	Model No.	Control outputs (OSSD 1, OSSD 2)
Safety laser scanner		SD3-A1	PNP open-collector transistor 2 outputs

Spare parts (Accessories for safety laser scanner)

Designation	Model No.	Description	
Straight connector for 15-pin connector side	SD3-PS	Exclusive 15-pin connector. Straight type. For soldering. Net weight: 35 g approx.	
Straight connector for 9-pin connector side	SD3-RS232	Exclusive 9-pin connector. Straight type. For soldering. Net weight: 30 g approx.	
Scanner window	SD3-WINDOW	Replacement lens for safety laser scanner body. Net weight: 45 g approx.	

Straight connector for 15-pin connector side

· SD3-PS



Two M5 (length 20 mm 0.787 in) hexagonsocket-head bolts, two M5 (length 16 mm 0.630 in) hexagon-socket-head bolts, and two cylindrical nuts are attached.

Straight connector for 9-pin connector side

• SD3-RS232

Two cylindrical nuts are



Scanner window

• SD3-WINDOW



FIBER SENSORS

LASER SENSORS PHOTO-ELECTRIC SENSORS

SENSORS

AREA SENSORS

PRESSURE / FLOW SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

ENDOSCOPE

LASER MARKERS PLC / TERMINALS

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

CURING SYSTEMS

Selection Guide Laser Scanner Single Beam Sensor Light Curtains Control Units Optical Touch Switch

SD3-A1

OPTIONS

Designation Model No.		Model No.	Description			
Mounting bracket MS-SD3-1		MS-SD3-1	Used to mount the safety laser scanner in rear direction. Net weight: 530 g approx.			
	Rear elbow connector	SD3-PS-L	Exclusive 15-pin connector. Rear elbow type. For soldering. Net weight: 35 g approx.			
15-pin connector side	Configuration plug	SD3-CP	15-pin connector with built-in memory that saves setting information. For soldering. Net weight: 35 g approx.			
	Configuration plug attached cable	SD3-CP-C5	Cable length: 5 m 16.404 ft Net weight: 690 g approx. (1 cable)			
		SD3-CP-C10	Cable length: 10 m 32.808 ft Net weight: 1.3 kg approx. (1 cable)			
		SD3-CP-C25	Cable length: 25 m 82.021 ft Net weight: 3.3 kg approx. (1 cable)	Cable with configuration plug. Min. bending radius: R50 mm R1.969 in		
		SD3-CP-C50	Cable length: 50 m 164.042 ft Net weight: 6.3 kg approx. (1 cable)			
		SD3-CP-C10-L	Cable length: 10 m 32.808 ft Elbow type Net weight: 1.3 kg approx. (1 cable)			
9-pin connector side	Rear elbow connector	SD3-RS232-L	Exclusive 9-pin connector used when PC is not connected. Rear elbow type. Cable soldering is possible. Net weight: 30 g approx.			
	PC connection cable	SD3-RS232-C3	Cable length: 3 m 9.843 ft Net weight: 160 g approx. (1 cable)	Exclusive 9-pin connector		
		SD3-RS232-C5	Cable length: 5 m 16.404 ft Net weight: 230 g approx. (1 cable)	for RS-232C/422 with PC cab Min. bending radius:		
		SD3-RS232-C10	Cable length: 10 m 32.808 ft Net weight: 400 g approx. (1 cable)	R50 mm R1.969 in		
Operation checking tool		SD3-DEMO-24V	Configuration and test device for safety laser scanner. Supply voltage: 24 V DC, Net weight: 270 g approx.			
Cleaning set		SD3-CLEAN1	Used to clean scanner window (lens surface). Cleaning fluid 150 mt, cleaning cloth 25 sheets.			
		SD3-CLEAN2	Used to clean scanner window (lens surface). Cleaning fluid 1 \(\ell \), cleaning cloth 100 sheets.			

Mounting bracket

• MS-SD3-1



Two M8 (length 45 mm 1.772 in) hexagon-sockethead bolts, two plain washers for M8, two M5 (length 20 mm 0.787 in) hexagon-sockethead bolts, two M5 (length 16 mm 0.630 in) hexagon-sockethead bolts, and four plain washers for M5 are attached.

Rear elbow connector

· SD3-PS-L



Two cylindrical nuts are attached.

Configuration plug

· SD3-CP



Two cylindrical nuts are attached.

Configuration plug attached cable

· SD3-CP-C□

• SD3-CP-C10-L





Rear elbow connector

• SD3-RS232-L



Two cylindrical nuts are attached.

PC connection cable

• SD3-RS232-C□



Operation checking tool

• SD3-DEMO-24V



One exclusive connection cable is attached.

Cleaning set

• SD3-CLEAN1 • SD3-CLEAN2





SPECIFICATIONS

	T		0-6-6-1			
Type Model No.		Safety laser scanner				
Item	Model No.		SD3-A1			
Applicable	International standards	IEC 61496-1/3 (Type 3), ISO 13849-1 (Category 3, PLd), IEC 61508-1 to 7 (SIL2), IEC 62061 (SIL2)				
standards	Japan	JIS B 9704-1/3 (Type 3), JIS B 9705-1 (Category 3), JIS C 0508 (SIL2)				
	Europe (EU)	EN 61496-1 (Type 3), ISO 13849-1 (Category 3, PLd), EN 61508-1 to 7 (SIL2)				
Detection zone	Min. sensing object setting	ø150 mm ø5.906 in	ø50 mm ø1.969 in	ø40 mm ø1.575 in	ø30mm ø1.181 in	
	Sensing range (radius)	0 to 4.0 m 0 to 13.123 ft 0 to 4.0 m 0 to 13.123 ft	0 to 2.8 m 0 to 9.186 ft	0 to 2.2 m 0 to 7.218 ft	0 to 1.6m 0 to 5.249 ft	
	Measurement error margin extended range	When dust suppression function is not selected: 83 mm 3.268 in When dust suppression function is selected: 83 mm 3.268 in for less than 3.5 mm 0.138 in, and 100 mm 3.937 in for 3.5 mm 0.138 in or more (automatically calculated using the included software)				
	Sensing object reflectance	Minimum 1.8 %				
10/	Min. sensing object setting	ø150 mm ø5.906 in (fixed)				
Warning zone	Sensing range (radius)	0 to 15 m 0 to 49.213 ft				
	Sensing object reflectance	Minimum 20 %				
Measurement zone	Max. measurement range (radius)		50 m 164.042 ft (fixed)			
Scanning an	gle		190° / 180° (by setting)			
Number of z	one setting	Max. 7 + 1 (without detection zone) [Zone pairs in combination of detection zone and warning zone can be switched over by external input]				
Min. zone se	tting range		200 mm 7.874 in			
Supply volta	ge (UB)	2	24 V DC ⁺²⁰ ₋₃₀ % (IEC 60742	2)		
Current cons	sumption	300 mA appr	ox. (excluding external cor	nnection load)		
Fuse (power	supply)	1.25 A semi-time-lag fuse				
Control outputs (OSSD 1, OSSD 2)		PNP open-collector transistor 2 outputs Rated operating voltage: supply voltage (UB) – 3.2 V Max. source current: 250 mA Residual voltage: 3.2 V or less				
Operation mode		When no object enters into the detection zone: ON, When an object enters: OFF				
Respo	nse time	Min. 80 ms (2 scans) to max. 640 ms (16 scans) switching method				
Protect	ion circuit	Incorporated				
Warning output 1 (Alarm 1)		PNP open-collector transistor Rated operating voltage: supply voltage (UB) – 4 V Max. source current: 100 mA Residual voltage: 4 V or less				
Operation mode		Switching method of operation mode (set by below) Not used Main unit at normal operation: ON, Abnormal operation: OFF When no object enters into the warning zone: ON, When an object enters: OFF Main unit at normal operation: ON, Abnormal operation: OFF and When no object enters into the warning zone: ON, When an object enters: OFF				
Respo	nse time	Min. 80 ms (2 scans) to max. 640 ms (16 scans) switching method				
Warning output 2 (Alarm 2)		PNP open-collector transistor • Rated operating voltage: supply voltage (UB) – 4 V • Max. source current: 100 mA • Residual voltage: 4 V or less				
Operat	ion mode	Main unit at normal operation: ON, Abnormal operation: OFF				
Laser protec	tion class	Clas	ss 1 [IEC 60825, FDA (Not	e 2)]		
Peak emission wavelength		905 nm 0.036 mil				
g Degree	of protection	IP65				
Ambiei	nt temperature	0 to +50 °C +32 to +122 °F, Storage: -20 to +60 °C -4 to +140 °F			·	
Degree Ambier Vibration of Control of Contro	nt humidity	Operation and storage: Max. 95 % RH (No dew condensation)				
Vibration r	esistance / Shock resistance	10 to 150 Hz frequency, 5 G max. (50 m/s² approx.) in X, Y and Z directions for twenty times each			mes each	
Maximum cable length		15-pin plug: Max. 50 m 164.042 ft, 9-pin plug: Max. 10 m 32.808 ft (when using RS-232C) / Max. 50 m 164.042 ft (when using RS-422) (by using optional connection cable) (Note 1)				
Material		Main body: Die-cast aluminum, Scanner window: Thermoplastic resin				
Accessories		SD3-PS (exclusive 15-pin connector): 1 pc., SD3-RS232 (exclusive 9-pin connector): 1 pc., Mounting screws [M5 (length 20 mm 0.787 in) hexagon-socket-head bolt: 2 pcs., M5 (length 16 mm 0.630 in) hexagon-socket-head bolt: 2 pcs., attached to SD3-PS]: 1 set, Simplified instruction manual: 1 copy, Installation CD-ROM (includes detailed instruction manual data): 1 CD				
Weight		Net weight: 2.1 kg approx., Gross weight: 2.9 kg approx.				
		<u> </u>				

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

MICRO

AREA SENSORS

PRESSURE FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

ENDOSCOPE

LASER MARKERS

PLC / TERMINALS

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION

COMPONENTS MACHINE VISION SYSTEMS CURING SYSTEMS

Lase Scanne Single Beam Sensor Light Curtains


Control Units Optical Touch Switch

Definition of Sensing Heights

SD3-A1

I/O CIRCUIT AND WIRING DIAGRAMS

Connection wiring example with control unit SF-C13

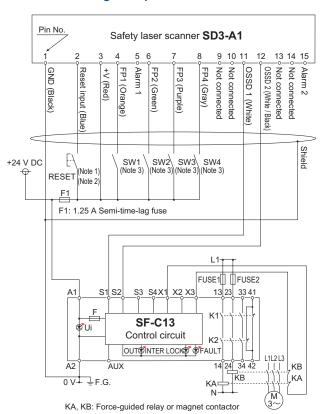

Notes: 1) The above diagram is when using manual reset. If automatic reset is used, a reset (RESET) button is not needed. Settings by software are needed separately.

- 2) Use a momentary-type switch as the reset (RESET) button.
- 3) For zone-control inputs (SW1 to 4), use PLC etc. (input time should be 40 ms or less).

Zone No.	Control inputs				
Zone No.	FP1	FP2	FP3	FP4	
1	1	0	0	0	
2	0	1	0	0	
3	0	0	1	0	
4	0	0	0	1	
5	1	1	1	0	
6	1	1	0	1	
7	1	0	1	1	
8	0	1	1	1	

PRECAUTIONS FOR PROPER USE

Refer to General precautions and About laser beam.

Wiring

- · Make sure that the power supply is off while wiring.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.
- Faulty wiring can damage internal circuitry so check the wiring before turning the power on.


Others

- · Avoid using the device in places that are humid and dusty, places where water and medicine are stored, or where there are corrosive gases in the air.
- Take care that the sensor does not come in direct contact with water, oil, grease or organic solvents, such as, thinner, etc.

TROMIC 46 Produkte, Support und Service


DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.

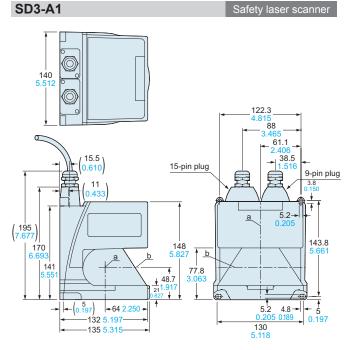

- a: Rotating mirror axis b: Scan level (beam axis)

MS-SD3-1 Mounting bracket (Optional)

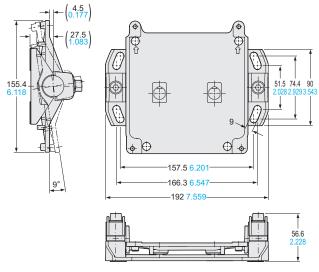

Material: Aluminum Net weight: 530 g approx.

Two M8 (length 45 mm 1.772 in) hexagon-socket-head bolts, two plain washers for M8,

two M5 (length 20 mm 0.787 in) hexagon-socket-head bolts, two M5 (length 16 mm 0.630 in) hexagon-socket-head bolts,

and four plain washers for M5 are attached.